



Hewlett Packard
Enterprise

S.15.09.0027 Release Notes

Abstract

This document contains supplemental information for the S.15.09.0027 release.

Part Number: 5200-1267
Published: March 2016
Edition: 1

© Copyright 2016 Hewlett Packard Enterprise Development LP

The information contained herein is subject to change without notice. The only warranties for Hewlett Packard Enterprise products and services are set forth in the express warranty statements accompanying such products and services. Nothing herein should be construed as constituting an additional warranty. Hewlett Packard Enterprise shall not be liable for technical or editorial errors or omissions contained herein.

Confidential computer software. Valid license from Hewlett Packard Enterprise required for possession, use, or copying. Consistent with FAR 12.211 and 12.212, Commercial Computer Software, Computer Software Documentation, and Technical Data for Commercial Items are licensed to the U.S. Government under vendor's standard commercial license.

Links to third-party websites take you outside the Hewlett Packard Enterprise website. Hewlett Packard Enterprise has no control over and is not responsible for information outside the Hewlett Packard Enterprise website.

Acknowledgments

Microsoft®, Windows®, and Windows Server® are U.S. registered trademarks of the Microsoft group of companies.

Contents

1 S.15.09.0027 Release Notes.....	6
Description.....	6
Important information.....	6
Products supported.....	6
Compatibility/interoperability.....	6
Enhancements.....	7
Version S.15.09.0003.....	7
CDPv2 Transmit Capability.....	7
MAC Limit Notify.....	7
Reporting Config Changes.....	7
Terminal Line Width and Length.....	7
Fixes.....	8
Version S.15.09.0027.....	8
TFTP.....	8
Version S.15.09.0026.....	8
Config.....	8
Version S.15.09.0025.....	8
Crash.....	8
Version S.15.09.0024.....	8
Crash.....	8
File Transfer.....	8
TFTP.....	8
Web Management.....	9
Version S.15.09.0023.....	9
ARP.....	9
Config.....	9
Version S.15.09.0022.....	9
File Transfer.....	9
SSH.....	9
Version S.15.09.0021.....	9
Crash.....	9
SSH.....	9
Stacking.....	9
Transceivers.....	10
Version S.15.09.0020.....	10
Config.....	10
Event Log.....	10
IGMP.....	10
MAC Authentication.....	10
SNMP.....	10
Version S.15.09.0018.....	10
Management.....	10
Passwords.....	10
Version S.15.09.0017.....	10
LLDP.....	10
Loop Protection.....	11
Passwords.....	11
Trunking.....	11
Version S.15.09.0015.....	11
Authentication.....	11
CLI.....	11
GVRP.....	11

Management.....	11
Multicast.....	11
Version S.15.09.0014.....	11
Crash.....	11
DHCP.....	11
IGMP.....	12
Link.....	12
Multicast.....	12
PIM.....	12
Version S.15.09.0013.....	12
Crash.....	12
Include Credentials.....	12
Management.....	12
Web Management.....	12
Version S.15.09.0012.....	13
Authentication.....	13
Management.....	13
SNMP.....	13
Version S.15.09.0011.....	13
802.1X.....	13
IGMP.....	13
SSH.....	13
Version S.15.09.0010.....	13
CPU.....	13
Display Issue.....	13
Multicast.....	13
Spanning Tree.....	13
System.....	14
Version S.15.09.0007.....	14
Authentication.....	14
SNMP.....	14
TFTP.....	14
Version S.15.09.0005.....	14
Crash Messaging.....	14
Display Issue.....	14
MSTP.....	14
Port Security.....	14
Version S.15.09.0004.....	14
Authentication.....	14
CLI.....	15
Config.....	15
Crash.....	15
Multicast.....	15
SSL.....	15
Web Management.....	15
Upgrade information.....	15
Upgrading restrictions and guidelines.....	15
Support and other resources.....	15
Accessing Hewlett Packard Enterprise Support.....	15
Accessing updates.....	16
Hewlett Packard Enterprise security policy.....	16
Documents.....	17
Related documents.....	17
Websites.....	17
Customer self repair.....	17

Remote support.....	18
Documentation feedback.....	18

1 S.15.09.0027 Release Notes

Description

This release note covers software versions beginning with S.15.09.0003.

Product series supported by this software:

- HP 2520 Switch Series

Important information

To avoid damage to your equipment, do not interrupt power to the switch during the software update.

Products supported

This release applies to the following product models:

Product number	Description
J9137A	HP 2520-8-PoE Switch
J9138A	HP 2520-24-PoE Switch

Compatibility/interoperability

The switch web agent supports the following operating system and web browser combinations:

Operating System	Supported Web Browsers
Windows XP SP3	Internet Explorer 7, 8 Firefox 12
Windows 7	Internet Explorer 9, 10 Firefox 24 Chrome 30
Windows 8	Internet Explorer 9, 10 Firefox 24 Chrome 30
Windows Server 2008 SP2	Internet Explorer 8, 9 Firefox 24
Windows Server 2012	Internet Explorer 9, 10 Firefox 24
Macintosh OS	Firefox 24

Enhancements

This section lists released builds that include enhancements. Software enhancements are listed in reverse-chronological order, with the newest at the top of the list. Unless otherwise noted, each software version listed includes all enhancements added in earlier editions. No enhancements have been introduced since version S.15.09.0003.

NOTE: The number preceding the enhancement description is used for tracking purposes.

Version S.15.09.0003

CDPv2 Transmit Capability

CR_0000107011 When a Cisco VoIP phone boots up (or sometimes periodically), it queries the switch and advertises information about itself using CDPv2. The switch receives the VoIP VLAN Query TLV (type 0x0f) from the phone and then immediately sends the voice VLAN ID in a reply packet to the phone using the VLAN Reply TLV (type 0x0e). The phone then begins tagging all packets with the advertised voice VLAN ID.

MAC Limit Notify

PR_0000073085, CR_0000077875 The MAC Address Count feature provides a way to notify the switch management system when the number of MAC addresses learned on a switch port exceeds the permitted configurable number.

Reporting Config Changes

PR_0000069196, CR_0000074531 This feature provides the ability to track and report information about switch management processes on a per-user, per-session basis. Syslog or RADIUS will be used for logging the information.

Terminal Line Width and Length

CR_0000074537 For console/serial link and inbound telnet sessions, the switch output:

- Uses whatever width is set by the terminal program. If width is not specified, 80 characters is the default.
- Automatically wraps on word boundaries (such as spaces) for non-columnar output
- Automatically wraps on column boundaries for columnar output

Hewlett Packard Enterprise recommends that you do not set your terminal width (**terminal width <y>**) above 150 columns.

Fixes

Software fixes are listed in reverse-chronological order, from newest to oldest software version. Unless otherwise noted, each software version listed includes all the software fixes and enhancements added in previous versions listed below.

NOTE: The number preceding the fix description is used for tracking purposes.

Version S.15.09.0027

TFTP

CR_0000180230

Symptom: TFTP transfer does not work with packet sizes other than 1416 bytes.

Workaround: Configure TFTP client to use a packet size of 1416 bytes.

Version S.15.09.0026

Config

CR_0000175001 When the value of any event's `eventtype` is set to a non-default value, after the switch is rebooted, the new value that has been set does not take effect. The issue lies with reading of the value from the file after reload.

Version S.15.09.0025

Crash

CR_0000158589 When GVRP is configured and active, entering the command `no gvrp` might cause the switch to reboot unexpectedly with a message similar to `Health Monitor: Restr Mem Access, HW Addr=0x7c7342ae IP=0x3cd640 Task='mGarpCtrl' Task ID=0x5dbf400sp:0x1dc2618 lr:0x3c4bd8 msr: 0x00009032 xer: 0x20000000 cr: 0x48000400.`

Version S.15.09.0024

Crash

CR_0000146306 The switch uses TCP connections internally for inter-process communication. In a situation where an internal loopback TCP socket pair receives stimulus after an extended period of idle time, the switch might reboot unexpectedly with a message similar to `NMI event SW:IP=0x00e20c1c MSR:0x02029200 LR:0x00e077d0 cr: 0x44000400 sp:0x02b03c58 xer:0x00000000 Task='InetServer' Task ID=0xab31000.`

File Transfer

CR_0000148584 A configuration file with a blank community name in the **snmp-server host** entry cannot be downloaded to the switch. Although the switch does not allow the **snmp-server host** entry to be configured with a blank community name, earlier software bugs might cause this condition.

TFTP

CR_0000132721 Certain lines in the configuration file are sometimes incorrectly changed when imported via TFTP. For example, the configuration entry **snmp-server community public unrestricted** might have the **unrestricted** parameter removed when the configuration file is downloaded via TFTP.

Web Management

CR_0000151179 After clicking "Save" without making changes, the Web user interface incorrectly changes VLAN members to be untagged. This happens after selecting "VLAN Mgmt", clicking "Change", and then clicking "Save" without making any changes. Also, the VLAN port membership is not correctly displayed in the Web user interface, which is a display issue; the correct VLAN port membership can be seen with the command line interface (CLI).

Version S.15.09.0023

ARP

CR_0000145065 ARP packets sent to a broadcast destination address are forwarded twice by the switch.

Config

CR_0000138447 After a switch software update, SNMP community access privileges are incorrectly changed by the switch. The output of `show snmp-server` and the output of a `walkmib` command give different results, and neither output represents how the switch actually behaves for Manager or Operator access. This issue was introduced with CR_0000122623; if the access settings were configured on a switch without the CR_0000122623 fix, after updating to software with the CR_0000122623 fix the settings are changed.

Version S.15.09.0022

File Transfer

CR_0000113260 Attempts to upgrade software via PCM (ProCurve Manager) fail. Also, actions taken via the Web user interface might experience delayed responses or timeouts.

SSH

CR_0000114000 After rebooting the switch many times, the Operator public key might erroneously be removed from the config file.

CR_0000137266b This removes the CR_0000137266 fix: After rebooting the switch many times, the Operator public key might erroneously be removed from the config file. Instead, this issue is fixed with CR_0000114000.

Version S.15.09.0021

Crash

CR_0000115372 The switch might reboot unexpectedly with a message similar to `NMI event SW:IP=0x00000000 MSR:0x00000000 LR:0x00000000 cr: 0x00000000 sp:0x00000000 xer:0x00000000 Task='InetServer' Task ID=0xaad3000`.

CR_0000135900 In some situations it is possible for the switch to reboot unexpectedly with a message similar to `Software exception at alloc_free.c:646 -- in 'eDrvPoll', task ID = 0xa9a7a80 -> buf already freed by 0x0A9A7D40, op=0x0006003E`.

SSH

CR_0000137266 After rebooting the switch many times, the Operator public key might erroneously be removed from the config file.

Stacking

CR_0000121075 When stacking is enabled, the switch is accessible via the Web even after disabling the Web server, and via TELNET even after disabling TELNET.

Transceivers

CR_0000140560 The port shows link, but no traffic passes through a J4858C Gigabit-SX transceiver when the port is configured for **1000-full** operation.

Version S.15.09.0020

Config

CR_0000135481 After boot, a config file that has a trap destination community name with an open parenthesis "(" or a close parenthesis ")" cannot be downloaded to the switch.

Event Log

CR_0000127436 After the switch uptime reaches 497 days, the timestamp entries in the event log become erratic with gaps of several hours or days. In some cases, the timestamps revert to previous months and years, even though SNTP updates with those wrong timestamps report the correct date and time.

IGMP

CR_0000132149 Although the RFC requires that the switch with the lowest IP address becomes querier, a switch that is acting as querier stops being querier when it receives a query from a switch with a higher IP address.

CR_0000135527 A non-querier switch that receives a Join from the querier fails to send further Joins to the querier, resulting in loss of multicast traffic.

MAC Authentication

CR_0000129991 MAC Authentication fails when the **peap-mschapv2** parameter is included in the `aaa authentication` CLI command.

SNMP

CR_0000129191 When an SNMP trap destination is set for "no destinations", the log reports an entry of `unknown var type` when the event happens. Also, when the SNMP trap destination is set for "trap receivers only", traps are not sent.

CR_0000134672 The `entStateOper` OID from the Entity State MIB gives an incorrect value of 1 (unknown) instead of 3 (enabled), for some switches.

Version S.15.09.0018

Management

CR_0000134091 Disabling write access to an SNMP community via the Web user interface might cause the switch to become unresponsive to command input. The switch must be rebooted to regain management access.

Passwords

CR_0000134675 The switch does not automatically create a default username of **manager** or **operator** when a password is configured for those levels of access.

Version S.15.09.0017

LLDP

CR_0000132891 When an IP phone is connected directly to the switch, the output of the command `show lldp info remote-device` gives an incorrect value for the phone's IP address.

Loop Protection

CR_0000127150 Loop protection fails to detect a loop on a port configured for 802.1X authentication, if 802.1X is not enabled globally.

Passwords

CR_0000130921 If the switch is configured with a username and password, changing the password causes the username to also change. The username is changed to the default **manager** or **operator**, depending on which password is changed.

Trunking

CR_0000132453 When the switch has a total of four ports configured as LACP trunks, some trunk members always have LACP status of **blocked**. For example, with a single 4-port trunk, three members are blocked. With two 2-port trunks, one trunk has one member blocked and the other trunk functions properly.

Version S.15.09.0015

Authentication

CR_0000114480 In some situations a client cannot be authenticated.

CLI

CR_0000130897 Existing trap receiver entries might be overwritten by later entries.

GVRP

CR_0000129917 When the switch receives its own GVRP frames, it learns from them instead of dropping the frames.

CR_0000130090 After rebooting the switch, the configuration **unknown-vlans disable** does not work on trunks.

Management

CR_0000132070 Tagged packets sent to the switch agent with total Ethernet frame length = 64 bytes are not processed by the switch.

Multicast

CR_0000130559 Multicast packets with destination addresses in the reserved ranges are sent twice from the switch. This affects IGMP and/or IPv6 packets.

Version S.15.09.0014

Crash

CR_0000122568 With SSL enabled, an attempt to download software via the Web interface might cause the switch to reboot unexpectedly with a message similar to: `NMI event
SW:IP=0x006d1538 MSR:0x02029200 LR:0x006d19e4, cr: 0x28000800
sp:0x05197088 xer:0x20000000, Task=tHttpd Task ID=0xa955000.`

CR_0000127335 In some situations, issuing the `show tech all` command might cause the switch to reboot unexpectedly with a message similar to `Length Corruption`.

DHCP

CR_0000128754 If the switch is a DHCP client and the DHCP reply contains option 43 with sub-option codes that conflict with RFC 2132 options, the switch might use incorrect settings such as an incorrect subnet mask.

IGMP

CR_0000127628 In a topology where the host connects to a querier, the querier connects to a non-querier switch, the non-querier switch connects to a router, and the multicast source is beyond the router, the host might not receive the multicast stream. This happens because a **join** from the host that is received by the querier is not forwarded by the non-querier switch.

CR_0000127974 If a switch receives a PIM packet while it is in the querier election state, the switch gives up the querier role and does not forward multicast traffic.

Link

CR_0000127550 When two 2520-24 powered-on switches are connected via a 1 Gigabit copper link (using ports 25-28) and the ports are configured for Auto-MDIX, the link comes up, goes down, and stays down. If the switches are rebooted with the cable already connected, the problem does not occur.

Multicast

CR_0000125558 Multicast streams sometimes stop after a few minutes. Disabling IGMP restores the multicast stream. Other qualifiers: IP Multicast Route table may still “see” the stream, and VLAN ingress port may show the stream exists while the same VLAN egress port might not.

PIM

CR_0000128681 After a large number of multicast streams are added and old streams time out, the switch might get into a state where it is unable to add new multicast streams, responding with a message similar to `IpAddrMgr: Failed to allocate new SW IP multicast group, table full FIB entry.`

Version S.15.09.0013

Crash

CR_0000126799 Under unusual stress conditions, the switch might reboot unexpectedly with a message similar to `Software exception at fileTransfer.c:1144 -- in 'tHttpd', task ID = 0xa9389c0 -> Could not open file.`

CR_0000127541 While providing output for some `show` commands, the switch experiences a gradual loss of free memory. When memory is depleted, the switch might reboot unexpectedly with a message similar to `Software exception at svc_misc.c:831 -- in 'mSess3', task ID = 0x5d9ff40 -> Failed to malloc 16472 bytes.`

Include Credentials

CR_0000127700 With include credentials enabled, a config file that is saved to a TFTP server does not contain the SNMPv3 credentials.

Management

CR_0000127197 The 2520-8-PoE Switch (J9137A) might become inaccessible to in-band management until the switch is rebooted. Note that the switch's console port is unaffected and works properly during the problem time. This improves the original Management fix (CR_0000115882) in S.15.09.0012.

Web Management

CR_0000125239 After logging into the switch Web user interface, closing the tab on some Web browsers does not log the user out of the Web session.

Version S.15.09.0012

Authentication

CR_0000124607 Disconnecting an authenticated PC from an authenticated VoIP phone might cause the phone to lose its authentication. The phone must be disconnected from and then reconnected to the switch to recover.

Management

CR_0000115882 The 2520-8-PoE Switch (J9137A) might become inaccessible to in-band management until the switch is rebooted. Note that the switch's console port is unaffected and works properly during the problem time.

SNMP

CR_0000122623 After rebooting a switch configured for SNMP with the parameters **operator unrestricted**, the switch does not allow the user to set any read/write MIB objects.

Version S.15.09.0011

802.1X

CR_0000122837 Clients have issues with authentication when 802.1X and MAC Authentication are both configured on a port.

IGMP

CR_0000105902 IGMPv2 LEAVE processing functionality no longer works for a multicast group after receipt of IGMPv1 group specific membership query (GSMQ) packet when operating in IGMPv2 mode, even when **ip igmp forcedfastleave 1-24** is enabled.

SSH

CR_0000122795 SSH session disconnects when the SSH key re-exchange takes place.

Version S.15.09.0010

CPU

CR_0000123333 After the switch has been booted or upgraded to an S.15.xx version, the device may become unresponsive due to high CPU utilization.

Display Issue

CR_0000121028 Some MAC addresses are displayed incorrectly in the output of CLI commands `show lldp info remote-device` and `display lldp neighbor-information list`.

Multicast

CR_0000110677 GMRP Frames should flood to the VLAN just as multicast traffic does but are not flooding as expected.

Spanning Tree

CR_0000110052 In a topology with multiple MSTP regions and multiple same-cost links connecting the regions, the CST root port might change to a CST alternate port, and MSTP instances might be blocked on region boundary ports.

System

CR_0000123647 At times, the switch is unable to process packets that require CPU processing, taking from a few seconds up to minutes to complete the process. Symptoms include recurring BDPUs starvation, and `Out of pkt buffers; miss count: 0` error messages.

Version S.15.09.0007

Authentication

CR_0000109782 In some situations the switch stops sending RADIUS requests and client authentication fails.

SNMP

CR_0000119914 Adds the ability to configure port security via SNMP. This was not available in earlier S.15.09 software versions.

TFTP

CR_0000119184 The switch experiences a loss of free memory each time command output is copied to a TFTP server. When memory is no longer available, the TFTP will fail with a message similar to the following.

```
TFTP download in progress.  
Failed to allocate a new TFTP client.  
00000K Request failed.
```

Version S.15.09.0005

Crash Messaging

CR_0000114843 The output of an `NMI event` crash wrongly shows pointer values to be all zeros.

Display Issue

CR_0000118422 A MAC address that begins with a non-zero value is displayed incorrectly in CLI and Web interface output.

MSTP

CR_0000117421 A trunk has the default MSTP port priority = 4. If the trunk is configured with a port priority = 8 (which is the default for non-trunk gigabit ports), after saving the configuration and rebooting the switch, that port priority is wrongly changed to 4.

CR_0000117473 With MSTP enabled and multiple instances configured, LACP is incorrectly blocked on ports connected to MSTP-blocked ports.

Port Security

CR_0000114545 With port security enabled, the first packet received on the port is not forwarded by the switch. This can cause DHCP failures for clients that send only one DHCP Discover packet.

Version S.15.09.0004

Authentication

CR_0000114832 On a port configured for authentication with a **logoff-period** longer than the MAC age time, authenticated clients that send no traffic might be de-authenticated at the MAC age time instead of the configured **logoff-period**.

CLI

CR_0000115515 The switch does not allow configuration changes via the CLI, responding with the error message `inconsistent value`. This has been observed when the configuration includes **snmpv3 targetaddress TARGETADDRESS** with a **TARGETADDRESS** string longer than 24 characters.

Config

CR_0000117518 A switch configured with a username and password and with **include-credentials** cannot be accessed after updating software, because the username is wrongly removed from the config file during the software update.

Crash

CR_0000115929 With very large key sizes, the command `show crypto host-cert` might cause the switch to reboot unexpectedly with a message similar to the following.

```
Invalid Instr HW Addr=0x00000000 IP=0x0 Task='mSess2' Task ID=0xa97ad40  
sp: 0x4acecc8 lr: 0x57e468 msr: 0x02029200 xer: 0x20000000 cr: 0x28000400
```

CR_0000116647 It is possible for the switch to reboot unexpectedly with a message similar to the following.

```
Software exception in kernel context at ghsException.c:1101 -> Internal  
system error
```

Multicast

CR_0000107597 The switch floods GMRP (GARP Multicast Registration Protocol) packets that are received on Spanning Tree backup and alternate ports, instead of dropping the packets.

SSL

CR_0000115933 Under certain conditions, the VLAN -> VLAN Mgmt page on the switch cannot be accessed via an SSL connection to the web user interface.

Web Management

CR_0000108339 The switch's web user interface cannot be accessed via the fully-qualified domain name in some situations. **Workaround:** Use the IP address to access the switch's web user interface.

Upgrade information

Upgrading restrictions and guidelines

S.15.09.0027 uses BootROM S.14.03. If your switch has an older version of BootROM, the BootROM will be updated with this version of software.

Support and other resources

Accessing Hewlett Packard Enterprise Support

- For live assistance, go to the Contact Hewlett Packard Enterprise Worldwide website:
www.hpe.com/assistance
- To access documentation and support services, go to the Hewlett Packard Enterprise Support Center website:
www.hpe.com/support/hpesc

Information to collect

- Technical support registration number (if applicable)
- Product name, model or version, and serial number
- Operating system name and version
- Firmware version
- Error messages
- Product-specific reports and logs
- Add-on products or components
- Third-party products or components

Accessing updates

- Some software products provide a mechanism for accessing software updates through the product interface. Review your product documentation to identify the recommended software update method.
- To download product updates, go to either of the following:
 - Hewlett Packard Enterprise Support Center Get **connected with updates** page:
www.hpe.com/support/e-updates
 - Software Depot website:
www.hpe.com/support/softwaredepot
 - To view and update your entitlements, and to link your contracts and warranties with your profile, go to the Hewlett Packard Enterprise Support Center **More Information on Access to Support Materials** page:
www.hpe.com/support/AccessToSupportMaterials



IMPORTANT: Access to some updates might require product entitlement when accessed through the Hewlett Packard Enterprise Support Center. You must have an HPE Passport set up with relevant entitlements.

Hewlett Packard Enterprise security policy

A Security Bulletin is the first published notification of security vulnerabilities and is the only communication vehicle for security vulnerabilities.

- Fixes for security vulnerabilities are not documented in manuals, release notes, or other forms of product documentation.
- A Security Bulletin is released when all vulnerable products still in support life have publicly available images that contain the fix for the security vulnerability.

To find security bulletins:

1. Go to the HPE Support Center - Hewlett Packard Enterprise at www.hpe.com/support/hpesc.
2. Enter your product name or number and click **Go**.
3. Select your product from the list of results.
4. Click the **Top issues & solutions** tab.
5. Click the **Advisories, bulletins & notices** link.

To initiate a subscription to receive future Hewlett Packard Enterprise Security Bulletin alerts via email, sign up at:

Documents

To find related documents, see the Hewlett Packard Enterprise Support Center website: www.hpe.com/support/hpesc. Enter your product name or number and click **Go**. If necessary, select your product from the resulting list.

Related documents

The following documents provide related information:

- *HP Switch Software Access Security Guide K/KA/KB.15.18*
- *HP Switch Software Advanced Traffic Management Guide K/KA/KB.15.18*
- *HP Switch Software Basic Operation Guide*
- *HP Switch Software Feature and Commands Index*
- *HP Switch Software IPv6 Configuration Guide K/KA/KB.15.18*
- *HP Switch Software Management and Configuration Guide K/KA/KB.15.18*
- *HP Switch Software Multicast and Routing Guide K/KA/KB.15.18*
- *Premium License Installation Guide K/KA/KB.15.18*
- *HP OpenFlow 1.3 Administrator Guide K/KA/KB/WB.15.18*
- *HP Service Insertion Guide K/KA/KB/WB.15.18*

Websites

Website	Link
Networking websites	
Hewlett Packard Enterprise Networking Information Library	www.hpe.com/networking/resourcefinder
Hewlett Packard Enterprise Networking website	www.hpe.com/info/networking
Hewlett Packard Enterprise Networking My Support	www.hpe.com/networking/support
General websites	
Hewlett Packard Enterprise Information Library	www.hpe.com/info/enterprise/docs
Hewlett Packard Enterprise Support Center	www.hpe.com/support/hpesc
Contact Hewlett Packard Enterprise Worldwide	www.hpe.com/assistance
Subscription Service/Support Alerts	www.hpe.com/support/e-updates
Software Depot	www.hpe.com/support/softwaredepot
Customer Self Repair (not applicable to all devices)	www.hpe.com/support/selfrepair
Insight Remote Support (not applicable to all devices)	www.hpe.com/info/insightremotesupport/docs

Customer self repair

Hewlett Packard Enterprise customer self repair (CSR) programs allow you to repair your product. If a CSR part needs to be replaced, it will be shipped directly to you so that you can install it at your convenience. Some parts do not qualify for CSR. Your Hewlett Packard Enterprise authorized service provider will determine whether a repair can be accomplished by CSR.

For more information about CSR, contact your local service provider or go to the CSR website:

Remote support

Remote support is available with supported devices as part of your warranty or contractual support agreement. It provides intelligent event diagnosis, and automatic, secure submission of hardware event notifications to Hewlett Packard Enterprise, which will initiate a fast and accurate resolution based on your product's service level. Hewlett Packard Enterprise strongly recommends that you register your device for remote support.

For more information and device support details, go to the following website:

www.hpe.com/info/insightremotesupport/docs

Documentation feedback

Hewlett Packard Enterprise is committed to providing documentation that meets your needs. To help us improve the documentation, send any errors, suggestions, or comments to Documentation Feedback (docsfeedback@hpe.com). When submitting your feedback, include the document title, part number, edition, and publication date located on the front cover of the document. For online help content, include the product name, product version, help edition, and publication date located on the legal notices page.