

AOS-S Switch 16.11.0021 Release Notes



Copyright Information

© Copyright 2024 Hewlett Packard Enterprise Development LP.

This product includes code licensed under certain open source licenses which require source compliance. The corresponding source for these components is available upon request. This offer is valid to anyone in receipt of this information and shall expire three years following the date of the final distribution of this product version by Hewlett Packard Enterprise Company. To obtain such source code, please check if the code is available in the HPE Software Center at <https://myenterpriselicense.hpe.com/cwp-ui/software> but, if not, send a written request for specific software version and product for which you want the open source code. Along with the request, please send a check or money order in the amount of US \$10.00 to:

Hewlett Packard Enterprise Company
Attn: General Counsel
WW Corporate Headquarters
1701 E Mossy Oaks Rd Spring, TX 77389
United States of America.

Contents	3
Release Overview	4
Important Information	4
Terminology Change	4
Version History	4
Security Bulletin Subscription Service	6
Compatibility/Interoperability	6
Platforms and Minimum Supported Software Versions	6
KB 16.11	6
Minimum Supported Software Versions	7
WC 16.11	9
Minimum Supported Software Versions	10
YA/YB 16.11	11
Minimum Supported Software Versions	12
YC 16.11	13
16.11	15
Enhancements	15
Fixes	22
Issues and Workarounds	46
Upgrade Information	46
KB 16.11	47
WC 16.11	47
YA/YB 16.11	48
YC 16.11	48
Aruba Security Policy	48

These release notes include the following topics:

- [Important Information](#)
- [Terminology Change](#)
- [Version History](#)
- [Security Bulletin Subscription Service](#)
- [Compatibility/Interoperability](#)
- [Platforms and Minimum Supported Software Versions](#)

Important Information

To avoid damage to your equipment, do not interrupt power to the switch during a software update.

Terminology Change

As part of advancing HPE's commitment to racial justice, we are taking a much-needed step in overhauling HPE engineering terminology to reflect our belief system of diversity and inclusion. Some legacy products and publications may continue to include terminology that seemingly evokes bias against specific groups of people. Such content is not representative of our HPE culture and moving forward, Aruba will replace racially insensitive terms and instead use the following new language:

Usage	Old Language	New Language
Switch Security	Master	Main
Switch Routing	Master	Main Router
Smart Link	Master-Slave	Primary-Secondary
Chassis Events, IPv6 Configuration, and Troubleshooting	Master-Slave	Management-Slot
Switch Stack	Master-Slave	Conductor-Member
Switch Security, Configuration and Routing	Blacklist, Whitelist	Denylist, Allowlist
Route Type	Blackhole Route	Null Route
Type of Hackers	Black Hat, White Hat	Unethical, Ethical

Version History



All released versions are fully supported by Hewlett Packard Enterprise, unless noted in the table.

Table 1: Version History

Version number	Software	Release Date	Remarks
16.11.0021	KB, WC, YC, and YA/YB	2024-10-1	Released, fully supported, and posted on the web.
16.11.0020	KB, WC, YC, and YA/YB	2024-07-18	Released, fully supported, and posted on the web.
16.11.0019	KB and WC	2024-06-19	Released, fully supported, and posted on the web.
16.11.0018	KB, WC, YC, and YA/YB	2024-04-15	Released, fully supported, and posted on the web.
16.11.0017	KB, WC, YC, and YA/YB	-	Version 16.11.0017 is unavailable for download.
16.11.0016	KB, WC, YC, and YA/YB	2024-01-25	Released, fully supported, and posted on the web.
16.11.0015	KB, WC, YC, and YA/YB	2023-11-27	Released, fully supported, and posted on the web.
16.11.0014	KB, WC, YC, and YA/YB	2023-09-22	Released, fully supported, and posted on the web.
16.11.0013	KB, WC, YC, and YA/YB	2023-07-31	Released, fully supported, and posted on the web.
16.11.0012	KB, WC, YC, and YA/YB	2023-05-29	Released, fully supported, and posted on the web.
16.11.0011	KB, WC, YC, and YA/YB	2023-04-10	Released, fully supported, and posted on the web.
16.11.0010	KB, WC, YC, and YA/YB	2023-02-15	Released, fully supported, and posted on the web.
16.11.0009	KB, WC, YC, and YA/YB	-	Version 16.11.0009 is unavailable for download.
16.11.0008	KB, WC, YC, and YA/YB	2022-11-14	Released, fully supported, and posted on the web.
16.11.0007	KB, WC, YC, and YA/YB	2022-10-03	Released, fully supported, and posted on the web.
16.11.0006	KB, WC, YC, and YA/YB	2022-07-29	Released, fully supported, and posted on the web.

Version number	Software	Release Date	Remarks
16.11.0005	KB, WC, YC, and YA/YB	2022-05-30	Released, fully supported, and posted on the web.
16.11.0004	KB, WC, YC, and YA/YB	2022-03-16	Released, fully supported, and posted on the web.
16.11.0003	KB, WC, YC, and YA/YB	2021-12-13	Released, fully supported, and posted on the web.
16.11.0002	KB, WC, YC, and YA/YB	2021-09-30	Released, fully supported, and posted on the web.
16.11.0001	KB, WC, YC, and YA/YB	2021-09-13	Initial release of the 16.11 branch. Released, fully supported, and posted on the web.

Security Bulletin Subscription Service

You can sign up at https://sirt.arubanetworks.com/mailman/listinfo/security-alerts_sirt.arubanetworks.com to initiate a subscription to receive future Aruba Security Bulletin alerts via email.

Compatibility/Interoperability

The switch web agent supports the following web browsers:

- Internet Explorer- Edge, 11
- Chrome- 53, 52
- Firefox- 49, 48
- Safari (MacOS only)- 10, 9



HPE recommends using the most recent version of each browser as of the date of this release note.

Platforms and Minimum Supported Software Versions

This release is applicable to the following platforms and their respective switches:

- [KB 16.11](#)
- [WC 16.11](#)
- [YA/YB 16.11](#)
- [YC 16.11](#)

KB 16.11

This release applies to the following Aruba 5400R Switch Series and Aruba 3810M Switch Series:

Table 2: Products Supported

Product number	Description
J9821A	Aruba 5406R zL2 Switch
J9823A	Aruba 5406R 44G PoE+/2SFP+ (No PSU) v2 zL2 Switch
J9824A	Aruba 5406R 44G PoE+/4SFP (No PSU) v2 zL2 Switch
J9822A	Aruba 5412R zL2 Switch
J9825A	Aruba 5412R 92G PoE+/2SFP+ (No PSU) v2 zL2 Switch
J9826A	Aruba 5412R 92G PoE+/4SFP (No PSU) v2 zL2 Switch
J9868A	Aruba 5406R 8XGT/8SFP+ (No PSU) v2 zL2 Switch
JL001A	Aruba 5412R 92GT PoE+ / 4SFP+ (No PSU) v3 zL2 Switch
JL002A	Aruba 5406R 8 port 1/2.5/5/10GBASE T PoE+ / 8 port SFP+ (No PSU) v3 zL2 Switch
JL095A	Aruba 5406R 16 port SFP+ (No PSU) v3 zL2 Switch
JL003A	Aruba 5406R 44GT PoE+ / 4SFP+ (No PSU) v3 zL2 Switch
JL071A	Aruba 3810M 24G 1 slot Switch
JL072A	Aruba 3810M 48G 1 slot Switch
JL073A	Aruba 3810M 24G PoE+ 1 slot Switch
JL074A	Aruba 3810M 48G PoE+ 1 slot Switch
JL075A	Aruba 3810M 16SFP+ 2 slot Switch
JL076A	Aruba 3810M 40G 8 HPE Smart Rate PoE+ 1 slot Switch

Minimum Supported Software Versions



If your switch or module is not listed in the below table, it runs on all versions of the software.

Table 3: Minimum Supported Software Versions

Product number	Product name	Minimum software version
J9986A	HPE 24-port 10/100/1000BASE-T PoE+ MACsec v3 zL2 Module	KB.15.17.0003

Product number	Product name	Minimum software version
J9987A	HPE 24-port 10/100/1000BASE-T MACsec v3 zL2 Module	KB.15.17.0003
J9988A	HPE 24-port 1GbE SFP MACsec v3 zL2 Module	KB.15.17.0003
J9989A	HPE 12-port 10/100/1000BASE-T PoE+ / 12-port 1GbE SFP MACsec v3 zL2 Module	KB.15.17.0003
J9990A	HPE 20-port 10/100/1000BASE-T PoE+ / 4-port 1G/10GbE SFP+ MACsec v3 zL2 Module	KB.15.17.0003
J9991A	HPE 20-port 10/100/1000BASE-T PoE+ / 4p 1/2.5/5/10GBASE-T PoE+ MACsec v3 zL2 Module	KB.15.17.0003
J9992A	HPE 20-port 10/100/1000BASE-T PoE+ MACsec / 1-port 40GbE QSFP+ v3 zL2 Module	KB.15.17.0003
J9993A	HPE 8-port 1G/10GbE SFP+ MACsec v3 zL2 Module	KB.15.17.0003
J9995A	HPE 8-port 1/2.5/5/10GBASE-T PoE+ MACsec v3 zL2 Module	KB.15.17.0003
J9996A	HPE 2-port 40GbE QSFP+ v3 zL2 Module	KB.15.17.0003
JH231A	HPE X142 40G QSFP+ MPO SR4 Transceiver	KB.15.17.0003
JH232A	HPE X142 40G QSFP+ LC LR4 SM Transceiver	KB.15.17.0003
JH233A	HPE X142 40G QSFP+ MPO eSR4 300M XCVR	KB.15.17.0003
JH234A	HPE X242 40G QSFP+ to QSFP+ 1m DAC Cable	KB.15.17.0003
JH235A	HPE X242 40G QSFP+ to QSFP+ 3m DAC Cable	KB.15.17.0003
JH236A	HPE X242 40G QSFP+ to QSFP+ 5m DAC Cable	KB.15.17.0003
JL001A	Aruba 5412R 92GT PoE+ / 4SFP+ (No PSU) v3 zL2 Switch	KB.15.17.0003
JL002A	Aruba 5406R 8-port 1/2.5/5/10GBASE-T PoE+ / 8-port SFP+ (No PSU) v3 zL2 Switch	KB.15.17.0003
JL003A	Aruba 5406R 44GT PoE+ / 4SFP+ (No PSU) v3 zL2 Switch	KB.15.17.0003
JL095A	Aruba 5406R 16-port SFP+ (No PSU) v3 zL2 Switch	KB.15.17.0003
JL075A	Aruba 3810M 16SFP+ 2-slot Switch	KB.16.01.0004

Product number	Product name	Minimum software version
JL071A	Aruba 3810M 24G 1-slot Switch	KB.16.01.0004
JL073A	Aruba 3810M 24G PoE+ 1-slot Switch	KB.16.01.0004
JL076A	Aruba 3810M 40G 8 HPE Smart Rate PoE+ 1-slot Switch	KB.16.01.0004
JL072A	Aruba 3810M 48G 1-slot Switch	KB.16.01.0004
JL074A	Aruba 3810M 48G PoE+ 1-slot Switch	KB.16.01.0004
JL081A	Aruba 3810M/2930M 4 1/2.5/5/10 GbE HPE Smart Rate Module	KB.16.04.0008
JL308A	Aruba 40G QSFP+ LC Bidirectional 150m MMF 2-strand Transceiver	KB.16.04.0008
JL745A	Aruba 1G SFP LC SX 500m MMF TAA XCVR	KB.16.10.0007
JL746A	Aruba 1G SFP LC LX 10km SMF TAA XCVR	KB.16.10.0007
JL747A	Aruba 1G SFP RJ45 T 100m Cat5e TAA XCVR	KB.16.10.0007
JL748A	Aruba 10G SFP+ LC SR 300m MMF TAA XCVR	KB.16.10.0007
JL749A	Aruba 10G SFP+ LC LR 10km SMF TAA XCVR	KB.16.10.0007



For information on networking application compatibility, see the Software Feature Support Matrix.

WC 16.11

This release applies to the following Aruba 2930F Switch Series and Aruba 2930M Switch Series:

Table 4: *Products Supported*

Product number	Description
JL253A	Aruba 2930F 24G 4SFP+ Switch
JL254A	Aruba 2930F 48G 4SFP+ Switch
JL255A	Aruba 2930F 24G PoE+ 4SFP+ Switch
JL256A	Aruba 2930F 48G PoE+ 4SFP+ Switch
JL258A	Aruba 2930F 8G PoE+ 2SFP+ Switch

Product number	Description
JL259A	Aruba 2930F 24G 4SFP Switch
JL260A	Aruba 2930F 48G 4SFP Switch
JL261A	Aruba 2930F 24G PoE+ 4SFP Switch
JL262A	Aruba 2930F 48G PoE+ 4SFP Switch
JL263A	Aruba 2930F 24G PoE+ 4SFP+ TAA-compliant Switch
JL264A	Aruba 2930F 48G PoE+ 4SFP+ TAA-compliant Switch
JL319A	Aruba 2930M 24G 1-slot Switch
JL320A	Aruba 2930M 24G PoE+ 1-slot Switch
JL321A	Aruba 2930M 48G 1-slot Switch
JL322A	Aruba 2930M 48G PoE+ 1-slot Switch
JL323A	Aruba 2930M 40G 8SR PoE+ 1-slot Switch
JL324A	Aruba 2930M 24SR PoE+ 1-slot Switch
JL557A	Aruba 2930F 48G PoE+ 4SFP 740W Switch
JL558A	Aruba 2930F 48G PoE+ 4SFP+ 740W Switch
JL559A	Aruba 2930F 48G PoE+ 4SFP+ 740W TAA-compliant Switch
JL692A	Aruba 2930F 8G PoE+ 2SFP+ TAA Switch
JL693A	Aruba 2930F 12G PoE+ 2G/2SFP+ Switch
R0M67A	Aruba 2930M 40G 8 HPE Smart Rate PoE Class 6 1-slot Switch
R0M68A	Aruba 2930M 24 HPE Smart Rate PoE Class 6 1-slot Switch

Minimum Supported Software Versions



If your switch or module is not listed in the below table, it runs on all versions of the software.

Table 5: Minimum Supported Software Versions

Product number	Product name	Minimum software version
JL078A	Aruba 3810M/2930M 1-port QSFP+ 40GbE Module	WC.16.04.0004
JL083A	Aruba 3810M/2930M 4-port 100M/1G/10G SFP+ MACsec Module	WC.16.04.0004
JL308A	Aruba 40G QSFP+ LC Bidirectional 150m MMF 2-strand Transceiver	WC.16.04.0008
JL323A	Aruba 2930M 40G 8SR PoE+ 1-slot Switch	WC.16.04.0008
JL324A	Aruba 2930M 24SR PoE+ 1-slot Switch	WC.16.04.0008
JL557A	Aruba 2930F 48G PoE+ 4SFP 740W Switch	WC.16.05.0003
JL558A	Aruba 2930F 48G PoE+ 4SFP+ 740W Switch	WC.16.05.0003
JL559A	Aruba 2930F 48G PoE+ 4SFP+ 740W TAA-compliant Switch	WC.16.05.0003
R0M67A	Aruba 2930M 40G 8 HPE Smart Rate PoE Class 6 1-slot Switch	WC.16.07.0002
R0M68A	Aruba 2930M 24 HPE Smart Rate PoE Class 6 1-slot Switch	WC.16.07.0002
J9142B	HPE X122 1G SFP LC BX-D Transceiver	WC.16.07.0003
J9143B	HPE X122 1G SFP LC BX-U Transceiver	WC.16.07.0003
JL692A	Aruba 2930F 8G PoE+ 2SFP+ TAA Switch	WC.16.08.0005
JL693A	Aruba 2930F 12G PoE+ 2G/2SFP+ Switch	WC.16.10.0001
JL745A	Aruba 1G SFP LC SX 500m MMF TAA XCVR	WC.16.10.0007
JL746A	Aruba 1G SFP LC LX 10km SMF TAA XCVR	WC.16.10.0007
JL747A	Aruba 1G SFP RJ45 T 100m Cat5e TAA XCVR	WC.16.10.0007
JL748A	Aruba 10G SFP+ LC SR 300m MMF TAA XCVR	WC.16.10.0007
JL749A	Aruba 10G SFP+ LC LR 10km SMF TAA XCVR	WC.16.10.0007



For information on networking application compatibility, see the Software Feature Support Matrix.

YA/YB 16.11

This release applies to the following Aruba 2530 Switch Series:

Table 6: *Products Supported*

Product number	Description
J9783A	Aruba 2530 8 Switch
J9782A	Aruba 2530 24 Switch
J9781A	Aruba 2530 48 Switch
J9777A	Aruba 2530 8G Switch
J9776A	Aruba 2530 24G Switch
J9775A	Aruba 2530 48G Switch
J9780A	Aruba 2530 8 PoE+ Switch
J9779A	Aruba 2530 24 PoE+ Switch
J9778A	Aruba 2530 48 PoE+ Switch
J9774A	Aruba 2530 8G PoE+ Switch
J9773A	Aruba 2530 24G PoE+ Switch
J9772A	Aruba 2530 48G PoE+ Switch
JL070A	Aruba 2530 8 PoE+ Internal Power Supply Switch
J9856A	Aruba 2530 24G 2SFP+ Switch
J9855A	2530 48G 2SFP+ Switch
J9854A	2530 24G PoE+ 2SFP+ Switch
J9853A	2530 48G PoE+ 2SFP+ Switch

Minimum Supported Software Versions



If your switch or module is not listed in the below table, it runs on all versions of the software.

Table 7: Minimum Supported Software Versions

Product number	Product name	Minimum software version
J9856A	Aruba 2530 24G 2SFP+ Switch	YA.15.15.0006
J9855A	Aruba 2530 48G 2SFP+ Switch	YA.15.15.0006
J9854A	Aruba 2530 24G PoE+ 2SFP+ Switch	YA.15.15.0006
J9853A	Aruba 2530 48G PoE+ 2SFP+ Switch	YA.15.15.0006
J9783A	Aruba 2530 8 Switch	YB.15.12.0006
J9782A	Aruba 2530 24 Switch	YB.15.12.0006
J9780A	Aruba 2530 8 PoE+ Switch	YB.15.12.0006
J9779A	Aruba 2530 24 PoE+ Switch	YB.15.12.0006
J9781A	Aruba 2530 48 Switch	YA.15.12.0006
J9778A	Aruba 2530 48 PoE+ Switch	YA.15.12.0006
J9777A	Aruba 2530 8G Switch	YA.15.12.0006
J9774A	Aruba 2530 8G PoE+ Switch	YA.15.12.0006
J9776A	Aruba 2530 24G Switch	YA.15.10.0003
J9775A	Aruba 2530 48G Switch	YA.15.10.0003
J9773A	Aruba 2530 24G PoE+ Switch	YA.15.10.0003
J9772A	Aruba 2530 48G PoE+ Switch	YA.15.10.0003



For information on networking application compatibility, see the Software Feature Support Matrix.

YC 16.11

This release applies to the following Aruba 2540 Switch Series:

Table 8: Products Supported

Product number	Description
JL354A	Aruba 2540 24G 4SFP+ Switch
JL356A	Aruba 2540 24G PoE+ 4SFP+ Switch

Product number	Description
JL355A	Aruba 2540 48G 4SFP+ Switch
JL357A	Aruba 2540 48G PoE+ 4SFP+ Switch

This release note covers software versions for the 16.11 branch of the AOS-S software.

Version 16.11.0001 is the initial build of Major version 16.11 software. 16.11.0021 includes all enhancements and fixes in different versions of the 16.11 software.

Refer to the following topics for more information:

- [Enhancements](#)
- [Fixes](#)
- [Issues and Workarounds](#)

Enhancements

This section lists enhancements added to this branch of the software.

Software enhancements are listed in reverse-chronological order, with the newest on the top of the list. Unless otherwise noted, each software version listed includes all enhancements added in earlier versions.

Table 9: *Enhancements*

Version	Software	Switch	Description	Category
16.11.0021	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	No enhancements were included in version 16.11.0021.	NA
16.11.0020	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	No enhancements were included in version 16.11.0020.	NA
16.11.0019	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	No enhancements were included in version 16.11.0019.	NA
16.11.0018	KB WC	3810M 5400R 2930F 2930M	Support for the following 10G C-class transceivers: ■ HPE Aruba Networking 10G SFP+ LC SR 400m OM4 MMF C-Class Transceiver (S2P30A)	C-Class Transceivers

Version	Software	Switch	Description	Category
			<ul style="list-style-type: none"> ■HPE Aruba Networking 10G SFP+ LC LR 10km SMF C-Class Transceiver (S2P31A) ■HPE Aruba Networking 10G SFP+ LC ER 40km SMF C-Class Transceiver (S2P32A) 	
16.11.0017	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Version 16.11.0017 is unavailable for download.	NA
16.11.0016	KB WC	3810M 5400R 2930M	Support for switches to send device level stats metric information indicating the total power consumed by switch to Central.	Central Integration
16.11.0015	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Support for removing old ciphers in the host key algorithm has been added. A new configuration option has been introduced which allows customers to remove ssh-rsa ciphers. Customers will be able to remove and disable outdated ssh-rsa ciphers in the host key algorithm using ip ssh host-key-algorithm .	SSH
16.11.0015	KB WC	5400R 2930F	Support to verify VSF error logs that are being sent to Central has been introduced. The show logging command can be used in the switch to verify VSF error events.	Central Integration
16.11.0014	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	No enhancements were included in version 16.11.0014.	NA
16.11.0013	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	No enhancements were included in version 16.11.0013.	NA
16.11.0012	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	<p>Support for https-based firmware downloads from Aruba Central has been added.</p> <p>The firmware has been embedded with trust anchor for verifying the firmware repository server certificate. Updates are made to verify the Subject Alternative Name (SAN) from the server certificate and to limit the newly added trust anchor for only https-based firmware downloads.</p>	Central Integration

Version	Software	Switch	Description	Category
16.11.0011	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	No enhancements were included in version 16.11.0011.	NA
16.11.0010	KB WC YC	3810M 5400R 2930F 2930M 2540	<p>The User Role feature of the switch is enhanced to allow configuring the authentication client limits for a port. The following new attributes are added under the device context of user role.</p> <ul style="list-style-type: none"> ▪ <code>client-limit dot1x</code>: Configure the 802.1X client-limit . ▪ <code>client-limit mac-based</code>: Configure the mac-based client-limit on the client's port using the User Role. <p>When a client is authenticated with an user role with above attributes, the ports client limit is temporarily overridden. Multiple overrides are allowed on same port using user role or RADIUS VSA, only if the new limits are greater than already applied limit.</p>	User Role
16.11.0009	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Version 16.11.0009 is unavailable for download.	NA
16.11.0008	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	No enhancements were included in version 16.11.0008.	NA
16.11.0007	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	<p>A new configuration option is added in LLDP to mention which VLANs IP address should be included in the outbound LLDP advertisements of switch ports. The IPv4/IPv6 address configured statically or dynamically assigned through DHCP on the specified management VLAN will be included in the outbound LLDP advertisements.</p> <p>Syntax: <code>[no] lldp management-address vlan <vid></code></p> <ul style="list-style-type: none"> ▪ Interface level management address configuration will take precedence over 	LLDP

Version	Software	Switch	Description	Category
			<p>the newly introduced management VLAN address.</p> <ul style="list-style-type: none"> ■ In case of Multinetting, first IP address in the interface will be advertised. ■ Statically configured and dynamically assigned IP address of the LLDP management VLAN will be considered for advertising. ■ If the LLDP management VLAN has both IPv4 and IPv6 address configured, then both IPv4 and IPv6 address will be advertised. ■ If there is no IPv4 or IPv6 address present in the configured LLDP management VLAN, then the existing workflow will be used to select the management address. <p>Refer to the following documents for more information:</p> <ul style="list-style-type: none"> ◦ <i>Aruba 3810/5400R Management and Configuration Guide for AOS-S 16.11</i> ◦ <i>Aruba 2930F/2930M Management and Configuration Guide for AOS-S 16.11</i> ◦ <i>Aruba 2530 Management and Configuration Guide for AOS-S 16.11</i> ◦ <i>Aruba 2540 Management and Configuration Guide for AOS-S 16.11</i> 	
16.11.0007	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	<p>To provide a secured management connection to the switch, the following improvements are made:</p> <ul style="list-style-type: none"> ■ Disabled TELNET on default configuration (no telnet-server). ■ Disabled HTTP on default configuration (no web-management). ■ Enabled HTTPS on default configuration (web-management ssl) using the installed self-signed certificate. ■ Switch will redirect all HTTP request (including REST) to HTTPS, when HTTP is disabled and HTTPS is enabled. <p>The above configuration changes will be applied on firmware upgrade of switches with default configuration, i.e. only for switches that meet the following configuration criteria:</p>	Security

Version	Software	Switch	Description	Category
			<ul style="list-style-type: none"> Only the default VLAN must be present. The default VLAN should have DHCP IP rather than a static IP. AirWave should not be configured. Aruba Central URL should not be configured. Manger password should not be configured. 	
16.11.0006	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	<p>The IP Auth manager feature has been added to close a TCP connection from an unauthorized client by sending a TCP RST immediately after receiving a TCP SYN packet, rather than allowing a complete three-way TCP handshake and then sending a TCP RST.</p> <p>NOTE: When an unauthorized client connects via the OOBM port, the existing behaviour remains unchanged.</p>	Security
16.11.0005	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	No enhancements were included in version 16.11.0005.	NA
16.11.0004	KB WC	3810M 5400R 2930F 2930M	<p>OSPF Route Filtering feature provides an option to filter the intra-area routes from installing into local FIB table. By using this, operator can create <code>distribute-list</code> with one or more network addresses which will be used to filter the intra area routes in OSPFv2/OSPFv3.</p> <p>Syntax: OSPFv2: <code>distribute-list <IP-ADDR>/<Prefix-Len></code> OSPFv3: <code>distribute-list <IPV6-ADDR>/<Prefix-Len></code></p> <p>Refer to the following documents for more information:</p> <ul style="list-style-type: none"> ■ <i>Aruba 3810/5400R Multicasting and Routing Guide for AOS-S Switch 16.11</i> ■ <i>Aruba 3810/5400R IPv6 Configuration Guide for AOS-S Switch 16.11</i> ■ <i>Aruba 2930M/2930F Multicasting and Routing Guide for AOS-S Switch 16.11</i> 	OSPF/OSPFv3

Version	Software	Switch	Description	Category
			<p>■ <i>Aruba 2930M/2930F IPv6 Configuration Guide for AOS-S Switch 16.11</i></p>	
16.11.0004	KB WC	3810M 5400R 2930F 2930M	<p>Added support in Device fingerprinting (DFP) module to send protocol data to Aruba Central for telemetry.</p> <p>Added <code>options-list</code> parameter to device-fingerprinting CLI. Switch software is enhanced to collect DHCP options list and up to three instances of HTTP user agent headers.</p> <p>Syntax: <code>device-fingerprinting [policy]<PROFILE_NAME> dhcp [option-num <NUM> options-list]</code>. Refer to the following documents for more information:</p> <p><i>Aruba 3810/5400R Access Security Guide for AOS-S Switch 16.11</i></p> <p><i>Aruba 2930M/2930F Access Security Guide for AOS-S Switch 16.11</i></p>	Device Finger Printing
16.11.0003	KB WC	3810M 5400R 2930F 2930M	<p>The Enrollment over Secured Transport (EST) client feature is updated to download and renew the CA certificates from an EST server independent of application certificate enrollment. A new command <code>est-server <profile-name></code></p> <p><code>cacerts-download</code> is added to enable independent CA certificate download from the EST server. This enhancement initiates automatic CA certificate download and renewal when the existing TA profile is about to expire. The switch will use the existing <code>est-server <profile-name></code></p> <p><code>re-enrollment-prior-expiry</code> command to determine how many days in advance the renewal is to be done. A MIB has also been added to enable automatic download and renew of the CA certificates from the EST server.</p> <p>Refer to the following documents for more information:</p> <p>■ <i>Aruba 3810/5400R Management and Configuration Guide for AOS-S 16.11</i></p> <p>■ <i>Aruba 2930F/2930M Management and Configuration Guide for AOS-S 16.11</i></p> <p>■ <i>Aruba MIB and Trap Support Matrix for AOS-S 16.11</i></p>	EST

Version	Software	Switch	Description	Category
16.11.0002	KB WC YA/YB YC	3810M 5400R 2930F 2930M	<p>TCP timestamps are an extension to the original TCP stack, that was introduced to identify and reject old duplicate packets (PAWS) and to improve round-trip-time measurement. Using a scanner or other tool, an attacker can observe the TCP timestamp and determine the system uptime to gain information about the operational state of the system.</p> <p>To avoid such risks, a new command <code>ip tcp randomize-timestamp</code> has been introduced to randomize the TCP timestamp offsets per connection. Once the command is issued, all the newly established TCP sessions will use random offset along with the timestamp.</p> <p>A MIB has also been added to enable or disable the randomization of TCP timestamp offsets.</p> <p>Refer to the following documents for more information:</p> <ul style="list-style-type: none"> ■ <i>Aruba 3810/5400R Management and Configuration Guide for AOS-S 16.11</i> ■ <i>Aruba 2930F/2930M Management and Configuration Guide for AOS-S 16.11</i> ■ <i>Aruba 2530 Management and Configuration Guide for AOS-S 16.11</i> ■ <i>Aruba 2540 Management and Configuration Guide for AOS-S 16.11</i> ■ <i>Aruba MIB and Trap Support Matrix for AOS-S 16.11</i> 	Security
16.11.0002	KB WC	3810M 5400R 2930F 2930M	<p>This is an enhancement to an existing User-Based Tunneling <code>vlan-extend-enable</code> (VLAN-aware) mode. Silent devices like Programmable Logic Controller (PLC) devices do not initiate any traffic until they receive a message from the uplink server. Thus, such devices cannot leverage the benefits of colorless ports, which include being authenticated through a RADIUS server and being dynamically placed in a VLAN or being tunneled to a controller.</p> <p>To support such silent devices, a new command <code>tunneled-node-server ubt-wol-enable vlan <VLAN-ID-LIST></code> has been introduced. This command configures the silent client so that the controller allows the first packet from the silent server to reach the silent client without a user tunnel. This will initiate user authentication and tunnel formation.</p>	Support for Silent Device

Version	Software	Switch	Description	Category
			<p>A MIB has also been added to enable User-Based Tunneling Wake-on-LAN (WoL) on the specified VLANs.</p> <p>Refer to the following documents for more information:</p> <ul style="list-style-type: none"> ■ <i>Aruba 3810/5400R Management and Configuration Guide for AOS-S 16.11</i> ■ <i>Aruba 2930F/2930M Management and Configuration Guide for AOS-S 16.11</i> ■ <i>Aruba MIB and Trap Support Matrix for AOS-S 16.11</i> 	
16.11.0001	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2540	Updated all non-inclusive terminologies. Refer to Terminology Change for more information.	-

Fixes

This section lists released builds that include fixes found in this branch of the software. Software fixes are listed in reverse-chronological order, with the newest on the top of the list. Unless otherwise noted, each software version listed includes all fixes added in earlier versions.

The Symptom statement describes what a user might experience if this is seen on the network. The Scenario statement provides additional environment details and trigger summaries. When available, the Workaround statement provides a workaround to the issue for customers who decide not to update to this version of software.

The number that precedes the fix description is used for tracking purposes.

Table 10: *Fixed Issues*

Version	Bug ID	Software	Switch	Description	Category
16.11.0021	257271	KB WC YC	3810M 5400R 2930F 2930M 2540	<p>Symptom/Scenario: Switch intermittently fails to forward packets from clients even when the clients are successfully on-boarded and authenticated.</p> <p>Workaround: Flap the switch port to fix the issue.</p>	802.1X
16.11.0021	257322	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	<p>Symptom: Some switches are stuck in a high CPU utilization state due to eDhcpdProto task found in running state.</p> <p>Scenario: The issue occurred when the switch received a high amount of DHCP traffic.</p> <p>Workaround: Enabling and disabling DHCP will clear the CPU usage for the switch.</p>	Chassis Manager

Version	Bug ID	Software	Switch	Description	Category
16.11.0021	257330	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom/Scenario: Clients are unable to on-board with specific downloadable user-roles (DUR). This issue was observed intermittently.	User Role
16.11.0021	257377	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom/Scenario: Some users are able to apply a ACL to a management VLAN when it is not allowed. Workaround: Remove the ACL configuration for the management VLAN using CLI.	Management VLAN
16.11.0021	257381	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: Switch crashes and restarts when Qualys scans are initiated. Scenario: This issue occurred when the Qualys VMDR (Vulnerability Management, Detection and Response) scan was initiated.	Boot and Reload
16.11.0021	257385	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: Some switches crash with the following message: out of memory . Scenario: This issue occurred due to slow memory leakage and exhaustion.	VSF
16.11.0021	257396	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: Clients are unable to on-board and the following error message is logged when the user attempts to assign a downloadable user-roles (DUR) to a port: ACL error - unable to create ACL entry Scenario: This issue was observed when a client placed in critical role was moved to a regular role.	ACL
16.11.0021	257408	YA/YB YC	2530 2540	Symptom: Switch crashes with the following message: Software exception at wma_ctrl_sm.c:283 - in 'mWebAuth' Scenario: This issue occurred when user role, authentication order and server timeout was configured and the radius server was unreachable.	MAC Authentication
16.11.0021	257432	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: Some users do not receive HTTP response from the switch. Scenario: This issue occurred when HTTP requests were sent using Ansible scripts and the Ansible client interface experienced connection failures.	HTTP Server

Version	Bug ID	Software	Switch	Description	Category
				Workaround: Use Curl instead of Ansible to send HTTP requests.	
16.11.0020	257397	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom Users are unable to upgrade the switches from AOS-S 16.11.0018 to AOS-S 16.11.0019 version and an error message, Firmware image signature is not valid is displayed. Scenario: This issue occurred when users upgraded the switches using the WebUI.	WebUI
16.11.0020	257382	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: Manual SSH fails when the switch is acting as a server and AirWave Zero Touch Provisioning (ZTP) workflow is also affected. Scenario: This issue occurred when an SSH client running OpenSSH 8.0P1 or later version was used to establish an SSH connection with a factory default AOS-S switch.	Zero Touch Provisioning
16.11.0019	CNX-66302	KB WC	3810M 5400R 2930F 2930M	Symptom/Scenario: After a firmware upgrade to version 16.11.0018, switches on-boarded in Central did not send periodic device information statistics.	Central Integration
16.11.0018	257222	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: Switch fails to learn the MAC address of the firewall after the version upgrade. Scenario: This issue occurred in switches with QinQ enabled and service VLANs configured.	QinQ
16.11.0018	257275	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: Users experience random connectivity issues and packet processing failure. ARP entries are not resolved in the switch. Scenario: This issue occurred when an ICMPv6 NS (Neighbor Solicitation) packet with 'Anycast' as the destination address was sent from an IPv6 node. Workaround: Disable IPv6.	ARP
16.11.0018	257282	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom/Scenario: Switch crashes when show commands are configured with a backslash "\".	CLI
16.11.0018	257262	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: Switch crashes when Qualys scans are executed. Scenario: This issue occurred when the Qualys VMDR (Vulnerability Management, Detection and Response) scan was executed.	Boot and Reload

Version	Bug ID	Software	Switch	Description	Category
16.11.0018	257270	KB WC	3810M 5400R 2930F 2930M	Symptom/Scenario: Downloaded user roles for the switch are not working. Tunnel creation fails and clients are not on-boarded. Workaround: Move the client from one port to another.	ClearPass Policy Manager
16.11.0018	257302	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: Switch crashes with the following error message: Health Monitor: Read Error Restr Mem Access" for task "mIpAdMUpCt Scenario: This issue occurred when two stack switches were connected with OSPF point-to-point links and VXLAN was enabled.	VXLAN
16.11.0017	-	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Version 16.11.0017 is unavailable for download.	-
16.11.0016	257226	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: Switch crashes in SSH remote port forwarding scenarios. Scenario: This issue occurred when the switch was acting as an SSH server and the <code>ssh -R 6000:127.0.0.1:6000 manager@10.0.0.1</code> command was configured from an SSH client.	SSH
16.11.0015	257224 NOTE: Auto fixed by 257201.	WC	2930F	Symptom: Customers report SSH vulnerability alerts on the switch even after disabling CBC ciphers. The vulnerability scan reports the following: The target is using deprecated SHA-1 cryptographic settings to communicate. Scenario: This issue occurred while running the vulnerability scanner which listed the weak host key algorithms supported in the switch.	SSH
16.11.0015	257206	WC	2930F	Symptom/Scenario: The switch interface went into an error state immediately after the upgrade. CRC error was noticed on the DAC VSF link after the upgrade.	VSF
16.11.0015	257221	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: The switch fails to stay in sync with Central. Scenario: This issue occurred when ip igmp forward configuration pushed from Central did not get reflected in the switch.	Central Integration

Version	Bug ID	Software	Switch	Description	Category
16.11.0015	257229	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom/Scenario: The switch crashes immediately after configuring logging filter <> command options.	CLI
16.11.0015	257233	KB WC YC	3810M 5400R 2930F 2930M 2540	Symptom/Scenario: The message Authentication is not triggered appears both as debug log and throttled RMON log.	802.1X
16.11.0014	257001	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom/Scenario: Cold/Warm start trap are not seen intermittently in the customer setup when the switch is cold/warm booted.	SNMPv3
16.11.0014	257076	KB WC YC	3810M 5400R 2930F 2930M 2540	Symptom: Affected ports do not come with the LED blinking amber. Self test failure will be reported for the ports in the event log. Scenario: This issue occurred when the switch or the line card was rebooted with some SPF+ ports having 1G transceivers. Workaround: Reboot the switch or the reload the module.	Chassis Manager
16.11.0014	257114	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: Switch crashes with the following message: <code>Task='eDhcpv6Rly'</code> . Scenario: This issue occurred when the <code>dhcpv6 relay</code> command was configured with corrupted number of sockets causing the crash. Workaround: Disable the <code>dhcpv6 relay</code> command.	DHCP
16.11.0014	257077	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: DHCP clients did not receive their IP addresses. The DHCP lease time is decremented to zero and is still available in the binding table. Scenario: This issue occurred when multiple clients were connected to the server with a lease time of four minutes and ran the <code>dhcp client</code> command from the client device.	DHCP Snooping
16.11.0013	257138	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: A configuration template push from Aruba Central fails.	Central Integration

Version	Bug ID	Software	Switch	Description	Category
				Scenario: This issue occurred when the configuration template is updated to <code>dhcp-snooping vlan <vlanid> rnage> from dhcp-snooping vlan <vlan>.</code>	
16.11.0013	257136	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: The switch sends cold start trap instead of warm start trap after rebooting. Scenario: This issue occurred when the switch was rebooted with the <code>boot system/reload/reboot</code> command.	SNMPv3
16.11.0013	257133	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: Switch crashes with the following error message: <code>Software exception at vls_xmit.c:161 - in 'mBonjourCtrl'</code> Scenario: This issue occurred when an MDNS profile was configured with a corrupted MDNS packet causing the crash.	Boot and Reload
16.11.0013	257122	KB WC	3810M 5400R 2930F 2930M	Symptom: The client MAC address remains in the Port Access MAC-Based Client Session Table even when the client moves to a different switch. This leads to reaching the maximum limit of 256 authentications and prevents further MAC authentications. Scenario: This issue occurred when MAC authentication was configured on the switch and the PVLAN isolated client was moved from one switch to another switch.	MAC Authentication
16.11.0013	257104	KB WC	3810M 5400R 2930F 2930M	Symptom: OSPFv3 is not acknowledging specific LSU updates. Scenario: This issue occurred when two switches were connected with OSPFv3 enabled and one switch acted as an ABR sending LSU Type 4 containing router LSA with a non-zero LS ID.	OSPFv3
16.11.0013	257105	KB WC	3810M 5400R 2930F 2930M	Symptom: Switch fails to move to initial role when connectivity to the RADIUS server is lost. Scenario: This issue occurred when the clients were authenticated with user roles attributed with port-mode and when the RADIUS server connectivity became unreachable. Workaround: Toggle the port.	User Role
16.11.0013	257091	KB WC	3810M 5400R 2930F 2930M	Symptom: UBT user traffic will not get tunneled.	Tunneled Node

Version	Bug ID	Software	Switch	Description	Category
				<p>Scenario: This issue occurred when a MAC move of UBT users from one port to another was initiated.</p> <p>Workaround: Disable and enable the feature using <code>no tunneled-node-server enable</code> and <code>tunneled-node-server enable</code> commands.</p>	
16.11.0013	257073	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	<p>Symptom: Some DHCP client's DHCP offers are dropped by DHCP snooping.</p> <p>Scenario: This issue occurred when the server pool is configured with different subnet masks wider than /24 and when the client requests an unicast DHCP offer packet.</p> <p>Workaround: Configure multiple ranges in the pool excluding the following IP addresses: <code>■x.x.x.255</code> <code>■x.x.x.0</code></p>	DHCP Snooping
16.11.0013	257089	YA/YB YC	2530 2540	<p>Symptom: Some switches are unable to connect to Aruba Central. The switch crashed with the following error message: Internal error : HTTP/1.1 protocol missing. Please contact Aruba support.</p> <p>Scenario: This crash occurred due to a rare timing issue.</p> <p>Workaround: Disable and enable Aruba Central.</p>	Central Integration
16.11.0013	257089	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	<p>Symptom: Some switches are unable to connect to Aruba Central. The switch crashed with the following error message: Internal error : HTTP/1.1 protocol missing. Please contact Aruba support.</p> <p>Scenario: This crash occurred due to a rare timing issue.</p> <p>Workaround: Disable and enable Aruba Central.</p>	Central Integration
16.11.0013	257088	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	<p>Symptom: A configuration template push of <code>timesync</code> with <code>ntp</code> from Aruba Central fails.</p> <p>Scenario: This issue occurred when <code>timesync <></code> configuration was pushed from Aruba Central when NTP was enabled.</p>	Central Integration
16.11.0013	257082	KB WC YA/YB	3810M 5400R 2930F	<p>Symptom: NTP server authentication fails in Aruba Central.</p>	NTP

Version	Bug ID	Software	Switch	Description	Category
		YC	2930M 2530 2540	Scenario: This issue occurred when the NTP key was validated with <code>encrypt-credential</code> enabled in Aruba Central. Workaround: Reboot the switch after pushing the configurations.	
16.11.0013	257070	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: The switch crashed and reboots while accessing the WebUI. Scenario: This issue occurred when LLDP packets were sent with a system name TLV length of 255 by neighbour device. Workaround: Disable LLDP on the port which is connected to a device sending LLDP packets with the values mentioned above.	LLDP
16.11.0013	257063	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: The output of the command <code>show power-over-ethernet <port></code> displays PD Power Draw value in decimals while the corresponding REST API truncates it to a whole number. Scenario: This issue occurred when the REST API GET <code>/ports/<port>/poe/stat</code> command was configured.	REST API
16.11.0013	257049	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: Manager or operator credentials are lost after rebooting the switch. Scenario: This issue occurred when the command <code>include-credentials</code> was enabled and the switch was power cycled. Workaround: Save the switch configuration details after enabling <code>include-credentials</code> .	Credentials
16.11.0012	256928	KB WC YC	3810M 5400R 2930F 2930M 2540	Symptom: The interface module of the switch crashes with either of the following signatures. <ul style="list-style-type: none"> Ports 1-24,A subsystem went down: 12/15/22 08:31:08 KB.16.10.0020 646Software exception in kernel context at ghsException.c:1539-> Internal system error at 0x869e034 Ports 1-24,A subsystem went down: 12/11/22 02:42:10 KB.16.10.0020 646Health Monitor: Write Error Restr Mem AccessHW Addr=0xc04e1c18 IP=0x882bfbfc Task='mPmSlvCtrl' Task ID=0x6bce41c0Bus Err Data=0x00000000 Bus Err Status=0x100008d1 	Flex Port

Version	Bug ID	Software	Switch	Description	Category
				<pre>Status=0xb0000001 Bus Err Addr=0xec020f4</pre> <ul style="list-style-type: none"> Ports 9-16 subsystem went down: 12/08/22 01:09:01 <pre>KB.16.10.0020 646Health Monitor: Read Error Restr Mem AccessHW Addr=0xe0200410 IP=0x8800c74 Task='mIpAdMUptCt' Task ID=0x6bccc140Bus Err Data=0x00000000 Bus Err Status=0x100008d1 Status=0xb0000001 Bus Err Addr=0xec02f540</pre>	
16.11.0012	257080	KB WC YC	3810M 5400R 2930F 2930M 2540	<p>Symptom: VSF switch stack connected to Aruba Central crashes.</p> <p>Scenario: This crash is a rare scenario and occurred when one of the switch members was not able to collect the temperate data.</p>	Central Integration
16.11.0012	257033	KB WC YC	3810M 5400R 2930F 2930M 2540	<p>Symptom: The switch logs the event :Unsolicited Echo Reply from <ip address>.</p> <p>Scenario: This issue occurred when the DHCP server was enabled in the switch and the DHCP client connected to the switch for the first time.</p>	DHCP
16.11.0012	257023	KB WC YC	3810M 5400R 2930F 2930M 2540	<p>Symptom: amp-server secret is not encrypted even after configuring encrypt-credentials.</p> <p>Scenario: This problem occurred when the amp-server secret was configured, followed by encrypt-credentials, but the amp-server secret was not encrypted and appeared as plain-text under show running-config.</p>	Config
16.11.0012	257031	KB WC YC	3810M 5400R 2930F 2930M 2540	<p>Symptom: Switch crashes due to invalid memory access.</p> <p>Scenario: This issue occurred when the switch sent DFP data to Cisco ISE.</p> <p>Workaround: Configure the valid ClearPass IP address and credentials in the switch.</p>	Device Finger Printing
16.11.0012	257005	KB WC YC	3810M 5400R 2930F 2930M 2540	<p>Symptom: SSH session from the switch to AP505 does not close sometimes when the exit command is executed.</p> <p>Scenario: This issue occurred when the SSH session is established from the switch to AP 505. Execute the command exit.</p>	SSH

Version	Bug ID	Software	Switch	Description	Category
				Workaround: Use the key sequence ~.	
16.11.0012	257023	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: amp-server secret is not encrypted even after configuring encrypt-credentials. Scenario: This problem occurred when the amp-server secret was configured, followed by encrypt-credentials, but the amp-server secret was not encrypted and appeared as plain-text under <code>show running-config</code> .	Config
16.11.0012	257005	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: SSH session from the switch to AP505 does not close sometimes when the exit command is executed. Scenario: This issue occurred when the SSH session is established from the switch to AP 505. execute the command exit. Workaround: Use the key sequence ~.	SSH
16.11.0011	256897	KB WC	3810M 5400R 2930F 2930M	Symptom: The switch crashes with the message similar to Software exception in ISR at Interrupts_fd.c:1145 - > Excessive FD 0 interrupts. Scenario: This issue occurred when the IPSEC traffic was tunneled via UBT.	Tunneled Node
16.11.0011	256956	KB	3810M 5400R	Symptom: An incorrect community string is advertised from a neighbor AOS-S switch. Scenario: This issue occurred when the BGP community string with more than 3 digits was set in the format AS:NN on a KB platform switch and advertised to neighbor. Workaround: Use a shorter community string.	BGP
16.11.0011	256927	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: The devices that are not directly connected to the switch show up in the LLDP neighbour table. Scenario: This issue occurred when the device sent LLDPDUs with the STP multicast destination MAC address and STP was disabled in the switch. Workaround: Configure an ACL on the interface connected to the device to drop the packets with STP multicast destination MAC address.	LLDP
16.11.0011	256958	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: The top interface metric is empty in the dashboard page of WebUI. Scenario: This issue occurred when the WebUI was accessed 18 times or more with the duration of each access lasting more than a minute.	WebUI

Version	Bug ID	Software	Switch	Description	Category
				Workaround: Reboot the switch.	
16.11.0011	256991	KB WC YC	3810M 5400R 2930F 2930M 2540	<p>Symptom: The switch fails to come online.</p> <p>Scenario: This issue occurred when the <code>netservice</code> and <code>netdestination</code> was configured with <code>ip access-list</code> on the switch.</p> <p>Workaround: Remove the <code>netservice</code> configuration.</p>	Management Stacking
16.11.0011	256995	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	<p>Symptom: Unable to get the LAG MIB information through SNMP in the operator mode.</p> <p>Scenario: This issue occurred when the LACP and SNMP server community were configured in the operator mode and SNMP Walk was performed.</p>	SNMPv2
16.11.0011	256987	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	<p>Symptom: The switch crashes while connecting to Aruba Central.</p> <p>Scenario: This issue occurred when the switch running AOS-S16.07 or older version was upgraded to AOS-S 16.08 or a later version and attempted to connect to Aruba Central. This issue has a very low probability of occurrence.</p> <p>Workaround: Power cycle the switch one more time after the upgrade.</p>	REST Infrastructure
16.11.0011	256905	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	<p>Symptom: The switch passwords are not erased after <code>erase all</code> command is executed.</p> <p>Scenario: This issue occurred when the passwords were configured on the switch and then the <code>erase all</code> command was executed.</p> <p>Workaround: Execute <code>no password manager/no password operator</code> commands prior to the <code>erase all</code> command.</p>	Credentials
16.11.0011	256876	KB	3810M 5400R	<p>Symptom: HTTP traffic from clients does not pass through UBT.</p> <p>Scenario: This issue occurred when the UBT topology with device finger-printing was enabled on the switch. Device finger-printing must include HTTP protocol.</p> <p>Workaround: Disable device finger-printing.</p>	Device Finger Printing

Version	Bug ID	Software	Switch	Description	Category
16.11.0010	256816	KB WC	3810M 5400R 2930F 2930M	<p>Symptom: Some of the data displayed in the <code>show system power-supply detail</code> command output, such as AC MAIN Voltage and Power Supplied may be incorrect for some JL087A model PSUs.</p> <p>Scenario: This issue occurred when some of the JL087A model PSUs were powered on and the <code>show-system power-supply</code> command was executed and the output parameters like Voltage and Power were out of range.</p> <p>Note: This is an issue with the command output only and doesn't impact the PSU functionality.</p>	Chassis Manager
16.11.0010	256676	KB WC	3810M 5400R 2930F 2930M	<p>Symptom: The PSU is operational and delivering power, even though the status is displayed as <code>Faulted</code> in some PSU/PoE related <code>show</code> commands.</p> <p>Scenario: This issue occurred when the PSU fan had a failure and the PSU/PoE related <code>show</code> commands were executed.</p> <p>Note: PSU may be operational in this scenario although the related <code>show</code> commands indicate a fault. If the operating temperature is no longer ambient for PSU, it will shut down and the PSU operational state will match the output of the <code>show</code> command.</p>	Chassis Manager
16.11.0010	256679	KB WC	3810M 5400R 2930F 2930M	<p>Symptom: Switch event logs will not be generated even if PSU encounters multiple problems like over temperature, over current, fan fault, and so on.</p> <p>Scenario: This issue occurred when there was a recurring set of one or more PSU events, such as overcurrent, overheating, and so on. However, such events are not anticipated in most of the deployments.</p>	Chassis Manager
16.11.0010	256651	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	<p>Symptom: System memory depletes and the switch reboots after a few months of runtime.</p> <p>Scenario: This issue occurred when the switch was connected to AirWave, and the AirWave was polling certain MIBs including <code>ieee8021SpanningTreeDesignatedRoot</code> and <code>hpicfXpsSwitchModType</code>.</p>	Central Integration
16.11.0010	256812	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530	<p>Symptom: The simultaneous execution of <code>Show Tech</code> from the switch CLI and from Aruba Central may cause the switch to crash.</p>	Boot and Reload

Version	Bug ID	Software	Switch	Description	Category
			2540	Scenario: This issue occurred when the user executed the <code>Show Tech</code> command in CLI and Aruba Central in parallel.	
16.11.0010	256872	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	<p>Symptom: The switch crashes with the message similar to: <code>NMI event SW:IP=0x0ea80030 MSR:0x02029200 LR:0x0ea800cccr: 0x42000400 sp:0x1f5d46e8 xer:0x00000000Task='mDsnoopCtrl' Task ID=0x1f5d13a8.</code></p> <p>Scenario: This issue can occur if the DHCP snooping is enabled and the switch is processing continuous DHCP packets.</p> <p>Workaround: Disable the DHCP snooping.</p>	DHCP Snooping
16.11.0010	256887	KB WC	3810M 5400R 2930F 2930M	<p>Symptom: The switch management module crashes.</p> <p>Scenario: This issue occurred when the switch was configured with an initial role containing a <code>reauth-period</code>. The mac-auth clients were placed in the initial role as the controller was not reachable. Later, the controller connectivity was regained within the time window of the mac-auth client re-authentication.</p>	Coredump
16.11.0010	256860	KB WC	3810M 5400R 2930F 2930M	<p>Symptom: The switch will run out of ternary content addressable memory (TCAM) meter resources and the client authentication using user roles fails.</p> <p>Scenario: This issue occurred when the last port with DFP config was toggled for several times.</p>	Device Finger Printing
16.11.0010	256898	KB WC	3810M 5400R 2930F 2930M	<p>Symptom: Authentication fails due to an insufficient ACL resources error.</p> <p>Scenario: This issue occurred when the client was authenticated using a user role with a classifier configuration having a VLAN which was not configured on the switch.</p> <p>Workaround: Make sure that the VLANs used in classifier configuration is present in the switch.</p>	Access Control Lists (ACL)
16.11.0010	256935	YA/YB YC	2530 2540	<p>Symptom: The switch crashed with a message similar to <code>Software exception at wma_ctrl_sm.c:283 - in 'mWebAuth'.</code></p> <p>Scenario: This issue occurred when the <code>User Role</code>, <code>Auth order</code>, and <code>Server timeout</code> were configured on the switch, and RADIUS server was unreachable.</p>	Mac Authentication

Version	Bug ID	Software	Switch	Description	Category
16.11.0009	-	KB	3810M 5400R	Version 16.11.0009 is unavailable for download.	-
16.11.0008	256574	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	<p>Symptom: The switch crashes if the <code>ip tcp randomize-timestamp</code> configuration is present on the switch.</p> <p>Scenario: This issue occurred when the switch had the <code>ip tcp randomize-timestamp</code> configuration and SSH/Telnet/Web UI was established on the switch.</p> <p>Workaround: Remove the <code>ip tcp randomize-timestamp</code> configuration.</p>	Boot and Reload
16.11.0008	256762	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	<p>Symptom: The switch configuration fails with an <code>invalid oobm or 400 bad response error</code> when the RADIUS server is updated with <code>is_oobm</code> or <code>is_tls_oobm</code> and the value is updated from <code>False</code> to <code>False</code>.</p> <p>Scenario: This issue occurred when the PUT request was sent to the RADIUS server with <code>is_oobm</code> or <code>is_tls_oobm</code> and the value was updated from <code>False</code> to <code>False</code> (no change).</p>	REST APIs
16.11.0008	256800	KB	3810M 5400R	<p>Symptom: Clients experience random connectivity issues in a topology with the distributed trunking (DT) switches because connected devices' MAC addresses are learned on the inter switch connect (ISC) ports.</p> <p>Scenario: This issue occurred when the DT switches were not connected (inter switch connect) via a direct layer 1 connection, and ISC port flaps on either of the DT switches.</p> <p>Workaround: Clear MAC address on both the DT switches.</p>	Distributed Trunking
16.11.0008	256727	WC	2930F 2930M	<p>Symptom/Scenario: The switch crashes when the OSPF neighbor sends exactly 256 OSPF routes.</p> <p>Workaround: Configure the OSPF protocol with more or less than 256 OSPF routes.</p>	OSPF
16.11.0007	256543	KB WC	3810M 5400R 2930F 2930M	<p>Symptom: IPTV stream freezes on a periodic basis as the querier information is lost.</p> <p>Scenario: This issue occurred when IGMPv3 query was sent with a QQIC value lower than IGMPv2 config.</p>	IGMPv3

Version	Bug ID	Software	Switch	Description	Category
				Workaround: Change the querier interval value configured for IGMPv2 to a value higher than 60 seconds (default IGMPv2 querier interval).	
16.11.0007	256613	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom/Scenario: Some IP addresses for <code>save config</code> and <code>config change</code> in the traps will not be displayed in the AirWave.	AirWave
16.11.0007	256631	KB WC	3810M 5400R 2930F 2930M	Symptom/Scenario: UBT Client on one port will authenticate and a tunnel is established, but no traffic passes and the counter packets to non existent tunnel will increase. Other ports may function normally. Workaround: Disable or Enable either the tunneled-node-profile or the UBT user port.	Tunneled Node
16.11.0007	256695	KB WC	3810M 5400R 2930F 2930M	Symptom: Dynamically learned routes will lose the nexthop and traffic will not be forwarded. Scenario: This issue occurred when VRRP was configured in owner mode along with routing protocols. Workaround: Configure VRRP in backup mode when using routing protocols.	OSPFv2
16.11.0007	256733	KB WC	3810M 5400R 2930F 2930M	Symptom: IP SLA for reachability failed status shows garbage RTT value when polling using SNMP, i.e. <code>hpicfIpSlaHistSummRTT</code> returns non zero values even for unreachable history records. Scenario: This issue occurred when the IP SLA target was reachable for 25 intervals and then became unreachable.	IP SLA
16.11.0007	256575	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: The switch stops responding to valid SNMP packets. Scenario: This issue occurred when the UDP packets were sent without any data. After 65 packets, the switch will stop responding to valid packets.	SNMPv3
16.11.0007	256600	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: Client will not be in authenticated state until cached-reauth period. Scenario: This issue occurred when the 802.1x authentication was configured with the cached-reauth. Workaround:	802.1x

Version	Bug ID	Software	Switch	Description	Category
				<ul style="list-style-type: none"> First, enable the user-role authentication and then configure the critical user-role for the authentication port. Critical user-role should not have the reauth-period attribute and auth-order should be removed for the authentication port. 	
16.11.0007	256732	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: Local-user with group cannot be configured via SNMP. Scenario: This issue occurred when the local-user with group using SNMP was configured. Workaround: User can configure local-user with group using CLI configuration.	SNMPv2
16.11.0007	256672	YA/YB	2530	Symptom/Scenario: The switch fails to connect to activate with an error activate: EST enrollment with server failed because of Unable to generate CSR.	Central Integration
16.11.0006	256590	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom/Scenario: When a port is added to a VLAN from the Web UI, IPv6 will be enabled on the VLAN.	NextGen WebUI
16.11.0006	256541	KB WC	3810M 5400R 2930F 2930M	Symptom: Authentication or Accounting using RadSec server is delayed. Scenario: This issue occurred when there was only one RadSec server configured and the TLS connection to that server was terminated.	Radius
16.11.0006	256509	KB WC	3810M 5400R 2930F 2930M	Symptom: The BSR and RP candidate cannot be configured with a VLAN ID greater than 999. Scenario: This issue occurred when a VLAN ID greater than 999 was configured with <code>ip pim-sparse enabled</code> and <code>bsr-candidate/rp-candidate</code> was configured in <code>router pim/pim6</code> with the respective VLAN ID.	PIM Sparse Mode
16.11.0006	256491	KB WC YC	3810M 5400R 2930F 2930M 2540	Symptom: Multicast traffic stops for several seconds, causing the video stream to freeze.	IGMP

Version	Bug ID	Software	Switch	Description	Category
				Scenario: This issue occurred when multiple clients were connected to the same access switch (the access layer with AOS-S switches and distribution/core layer with CX switches) receiving the same multicast stream, and one of the clients sent an IGMP leave. This fix is only specific to IGMPv2.	
16.11.0006	256485	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: REST request over HTTPS fails as SSL connection is not established. Scenario: This issue occurred when a GET request with an empty JSON payload was sent. Workaround: Replace the empty JSON payload with <i>None</i> in the GET request.	REST APIs
16.11.0006	256372	KB WC YC	3810M 5400R 2930F 2930M 2540	Symptom: Traffic from the secondary VLAN does not reach the primary VLAN. Scenario: This issue occurred when there was a tagged trunk port in the secondary VLAN and the switch was rebooted. Workaround: Remove the tagged trunk configuration from the secondary VLAN and re-add the tagged trunk configuration to the secondary VLAN.	PVLAN
16.11.0006	256358	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: An invalid username or password grants the operator access to the switch's Web UI. Scenario: This issue occurred when a banner and a manager password were configured but not an operator password. Workaround: Remove the banner configuration.	WEB UI
16.11.0006	256561	YA/YB	2530	Symptom: Network access is denied for a 802.1X authenticated client. Scenario: This issue occurred when the 802.1X client was authenticated with the <code>auth-vid</code> and <code>unauth-vid</code> configurations. Workaround: Configure a client limit for the authenticator-enabled port.	802.1X
16.11.0005	256433	KB WC	3810M 5400R 2930F 2930M	Symptom: When an end client is moved between two different switches, authentication does not occur on the second switch. Scenario: This issue occurred when the MAC address of the end client is learned on the uplink port first (where authentication was not enabled) and later learned on an access port (where authentication was enabled).	Mac Authentication

Version	Bug ID	Software	Switch	Description	Category
16.11.0005	256424	KB WC	3810M 5400R 2930F 2930M	Symptom: Device fingerprinting fails when the first RADIUS server in the list is unreachable. Scenario: This issue occurred when there were more than one RADIUS server configured and the first server in the list was not reachable. Workaround: Keep the unreachable RADIUS server as the last entry in the list.	Device Finger Printing
16.11.0005	256420	KB WC YC	3810M 5400R 2930F 2930M 2540	Symptom/Scenario: The switch crashes after entering the <code>ip-recv-mac-address</code> command. Workaround: Use an interval value greater than 2 when configuring <code>ip-recv-mac-address</code> .	Boot and Reload
16.11.0005	256406	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: Traffic is sent directly to clients in VLANs that do not have an IP address configured instead of being sent to the gateway configured in the routing table. Scenario: This issue occurred when the switch had both Layer 2 and Layer 3 VLANs and IP client tracker was enabled. Workaround: Disable the IP client tracker. Note: The IP address of silent clients being tracked may not be learnt unless a port bounce is performed after a redundancy failover.	Static Routing
16.11.0005	256366	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom/Scenario: The switch crashes with a message similar to the following: Software exception at multMgmtUtil.c:259 - in 'mOobmCtrl' -> Internal error.	Coredump
16.11.0005	256349	KB WC	3810M 5400R 2930F 2930M	Symptom: The memory of the switch is slowly consumed until executing any CLI command results in an Out of memory message. Scenario: This issue occurred when the switch had <code>aaa</code> configured, was connected to Aruba Central, and had neighbours that shared LLDP information.	VSF
16.11.0005	256122	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: Tx drops are seen on the port after the trunk member is removed. Scenario: This issue occurred when the port was configured to be a member of the trunk and subsequently removed from the trunk when the port was down. The issue will be seen when a client is connected to the port.	LACP

Version	Bug ID	Software	Switch	Description	Category
				Workaround: Configure the trunk while the port is up.	
16.11.0005	256069	KB WC YC	3810M 5400R 2930F 2930M 2540	Symptom: The switch reports a selftest failure on transceiver ports with Rx timeout error. Scenario: This issue occurred when the 3810 stack rebooted with SFP+ flex modules and J8177D transceivers.	Chassis Manager
16.11.0005	256301	WC	2930F 2930M	Symptom: The port is mistakenly blocked by MACsec. Scenario: This issue occurred when MACSec was configured and the switch was up for approximately 100 days.	Mac_Sec
16.11.0005	256262	WC	2930F 2930M	Symptom: Delay in captive portal redirection. Scenario: This issue occurred when multiple clients were connected and when there were several TLS sessions from each client.	Captive Portal
16.11.0005	256247	WC	2930F 2930M	Symptom/Scenario: The stack topology shown in the <code>show stacking</code> output is Chain even though the actual topology is a Ring.	Back Plane Stacking
16.11.0004	256202	YA/YB	2530	Symptom: Unable to provision the switch from Aruba Activate and records an EST enrollment failure. Scenario: This issue occurred when the hostname for the EST enrollment server is not resolved during zero-touch provisioning (ZTP). Workaround: Ensure that the DHCP server provides a DNS server IP address.	CertManager
16.11.0004	256274	KB WC	3810M 5400R 2930F 2930M	Symptom/Scenario: VSF Stack Member crashed with a message similar to the following: Software exception at lava_chassis_slot_sm.c:3626 - in 'eChassMgr', task ID = 0x37b07bc0.	VSF
16.11.0004	256257	KB YA/YB YC	3810M 5400R 2530 2540	Symptom/Scenario: Certain transceivers had link issues in unsupported transceiver mode.	Transceivers
16.11.0004	256234	KB WC YC	3810M 5400R 2930F 2930M	Symptom: The <code>show rmon statistics <port no></code> command returns the wrong counter values.	CLI

Version	Bug ID	Software	Switch	Description	Category
			2540	Scenario: This issue occurred when the <code>clear statistics global</code> or <code>clear statistics <port no></code> was executed first and then <code>show rmon statistics <port no></code> .	
16.11.0004	256233	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: Client ports may encounter packet drops when multicast sources stream video over 500 Mbps. Scenario: This issue can occur when multiple clients from different ports subscribed to the same group, which streams using HD channels requiring high bandwidth. TX drops can occur when several clients change channels simultaneously. Workaround: Lower the bandwidth of the video streams to below 500 Mbps in order to avoid over-subscription of ports.	IGMP-NG
16.11.0004	256220	KB WC	3810M 5400R 2930F 2930M	Symptom: Missing OSPF routes. Scenario: This issue occurred when both userbased tunneling and OSPF are configured and either of the uplinks to the controller is down. <code>source-interface</code> to be configured for tunneled node when the switch has more than one vlan to the reach the controller.	OSPFv2
16.11.0004	256205	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: A configuration template push from Aruba Central fails. Scenario: This issue occurred when the end devices are connected to ports that are configured with <code>port-security</code> <code>learn-mode static</code> .	Central Integration
16.11.0004	256121	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: Web authentication fails when the switch is managed by Aruba Central (<code>aruba-central support-mode disable</code>). Scenario: This issue occurred when the switch connects to Aruba Central and <code>aruba-central support-mode</code> is disabled. Workaround: Execute <code>aruba-central support-mode enable</code> command so the switch is no longer managed by Aruba Central.	Web Authentication
16.11.0004	256140	KB	3810M 5400R	Symptom: The switch crashes with an error message: <code>NMI event</code> . Scenario: This issue occurred when the HP MSM 775 wireless controller was connected to the switch and <code>snmpwalk</code> was executed.	SNMPV2

Version	Bug ID	Software	Switch	Description	Category
16.11.0004	256167	KB WC	3810M 5400R 2930F 2930M	Symptom: Ports with per-port tunneled node (PPTN) configured may be disabled after a switch reboot. Scenario: This issue occurred when a device profile was configured with tunneled-node. Workaround: Disable and enable the problematic PPTN enabled port manually.	Tunneled Node
16.11.0004	256144	KB	3810M 5400R	Symptom: The switch is unable to establish a connection with Aruba Activate. Scenario: This issue occurred when the switch was first onboarded, but it can also happen after the switch is visible on Aruba Central.	Activate
16.11.0004	255916	KB	3810M 5400R	Symptom/Scenario: Slot crashes with signatures OMFP LPTR Err Status = 0x00000310 (DEC_ERR_CNT) and FR Error = 0x18000020 (ALLOC_CHIP_PORT_UNDERFLOW).	Basic Layer2
16.11.0004	256115	KB WC	3810M 5400R 2930F 2930M	Symptom: Although the switch does not react to pings or SSH commands, it continues to transit traffic. The event log contains a crash message. Scenario: This issue occurred when device fingerprinting was configured with DHCP protocol.	CPPM
16.11.0003	256037	KB WC YC	3810M 5400R 2930F 2930M 2540	Symptom: Clients are not authenticated on a switch port. Scenario: This issue occurred when multiple clients were connected to a single port (for example, a Personal Computer (PC) was connected to a phone), both MAC authentication and 802.1X authentication methods were attempted at the same time on the PC, and both the authentication methods used the same user role attribute. Workaround: Configure the auth-order parameter first with authenticator, and then with mac-based.	802.1X
16.11.0003	255940	KB WC YC	3810M 5400R 2930F 2930M 2540	Symptom: A switch crashes with a message similar to the following: Software exception at svc_misc.c:1088 - in 'mDHCPClient' -> Failed to malloc 9202 bytes	Aruba Central

Version	Bug ID	Software	Switch	Description	Category
				Scenario: This issue occurred when the switch attempted to reconnect to Aruba Central.	
16.11.0003	255928	KB WC YC	3810M 5400R 2930F 2930M 2540	Symptom/Scenario: A switch is unable to connect to Aruba Central.	Aruba Central
16.11.0003	255978	KB WC	3810M 5400R 2930F 2930M	<p>Symptom: A switch crashes with a message similar to the following: Software exception in ISR at pvDmaV1Rx.c -> ASSERT: No resources available!</p> <p>Scenario: This issue occurred when 802.1X and MAC authentication were enabled on the same port with auth-order, and the client was initially authenticated through MAC authentication with a user role having the port mode attribute.</p>	Authentication
16.11.0003	255896	KB	3810M 5400R	<p>Symptom: A stack member loses connection to the stack and gets stuck in a boot loop.</p> <p>Scenario: This issue occurred when the stacking links were configured as a full mesh, and two links went down leaving the stacking links in a chain configuration.</p>	Back Plan Stacking
16.11.0003	256123	KB	3810M 5400R	<p>Symptom: Received packet drops are observed on a port.</p> <p>Scenario: This issue occurred when the TCP traffic, with the push flag set, consumed 100% bandwidth on a 1G port of a V3 module.</p>	Interfaces
16.11.0003	255995	KB YC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	<p>Symptom: A switch crashes when the show port-access clients command is issued or when an SNMP GET operation is performed to get the MIB object hpicfUsrAuthMacAuthSessionStatsEntry.</p> <p>Scenario: The switch crashed when a MAC-authenticated client had a username of more than 40 characters.</p>	Authentication
16.11.0003	255120	YA/YB	2530	Symptom/Scenario: The Key Expansion Module of a Cisco 8851 phone does not power up.	PoE

Version	Bug ID	Software	Switch	Description	Category
				Workaround: Configure <code>poe-allocate-by</code> command with <code>class</code> parameter on the ports, and reduce the number of powered devices connected to the switch.	
16.11.0003	255819	YA/YB	2530	<p>Symptom: A switch crashes with a message similar to the following: SubSystem 100 went down: Health Monitor: Read Error Restr Mem Access</p> <p>Scenario: This issue occurred because of the following actions:</p> <ol style="list-style-type: none"> 1. An AP was authenticated with 802.1X port mode. 2. The AP was rebooted, and the 802.1X authentication configuration was removed from the port. 	802.1X
16.11.0003	256016	KB WC YC	3810M 5400R 2930F 2930M 2540	<p>Symptom: When a private VLAN is configured on a switch, the traffic from the secondary VLAN does not reach the primary VLAN.</p> <p>Scenario: This issue occurred when the switch was rebooted, and the secondary VLAN contained a tagged trunk or Link Aggregation Control Protocol (LACP) port.</p> <p>Workaround: Remove and add the tagged trunk or LACP configuration to the secondary VLAN.</p>	Private VLAN
16.11.0003	254566	KB WC	3810M 5400R 2930F 2930M	<p>Symptom: Traffic fails to pass through an IEEE 802.1ad tunnel.</p> <p>Scenario: This issue occurred because of the following reasons:</p> <ol style="list-style-type: none"> 1. A Small Form-factor Pluggable+ (SFP+) port was configured as an uplink. 2. IEEE 802.1ad was configured on the same port. 3. The switch was rebooted without a transceiver in the slot. 4. A 1G SFP transceiver was inserted during the runtime. <p>Workaround: Insert the 1G SFP transceiver, and then reboot the switch.</p>	IEEE 802.1ad
16.11.0003	256034	KB WC YA/YB	3810M 5400R 2930F	<p>Symptom: SNMP MIB files are not reachable, and the MIB file returns some errors.</p>	SNMP

Version	Bug ID	Software	Switch	Description	Category
		YC	2930M 2530 2540	Scenario: This issue occurred when the customer used an SNMP monitoring tool to read or parse the MIB files.	
16.11.0003	256050	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: A switch crashes when the WebUI Security > Clientspage is accessed. Scenario: The switch crashed when a MAC-authenticated client had a username of more than 40 characters.	Web UI
16.11.0002	255888	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom/Scenario: When a proxy server is configured on the switch, the switch does not onboard into Aruba Central or Activate.	Aruba Central
16.11.0002	255799	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom: The user is unable to copy a configuration file to the switch using Secure File Transfer Protocol (SFTP) and the following error message is displayed. Invalid input: grep usage error Scenario: This issue occurred when the pipe character () was used as a part of the command input for some configuration commands, such as the <code>banner motd</code> and <code>snmpv3 user</code> commands. Workaround: Do not use the pipe character () in the command input for the configuration commands.	Configuration
16.11.0002	255825	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom/Scenario: When a switch is rebooted through an SSH session, the <code>show boot-history</code> , <code>show logging</code> , and <code>boot</code> command outputs include the <code>Operator cold reboot from TELNET session message</code> instead of the <code>Operator cold reboot from SSH session message</code> .	SSH
16.11.0001	-	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	No fixes were included in version 16.11.0001.	-

Issues and Workarounds

The following are known open issues with this branch of the software.

The Symptom statement describes what a user might experience if this is seen on the network. The Scenario statement provides additional environment details and trigger summaries. When available, the Workaround statement provides a workaround to the issue.

Table 11: *Known Issues*

Version	Bug ID	Software	Switch	Description	Category
16.11.0019	257397	KB WC YA/YB YC	3810M 5400R 2930F 2930M 2530 2540	Symptom/Scenario: Users are unable to upgrade the switches from AOS-S 16.11.0018 to AOS-S 16.11.0019 or later versions using the WebUI and an error message, Firmware image signature is not valid is displayed. Workaround: Use the CLI command, copy tftp flash to upgrade the switches to AOS-S 16.11.0019 or later versions.	WebUI
16.11.0010	256986	KB WC	3810M 5400R 2930F 2930M	Symptom/Scenario: UBT Client on one port will authenticate and a tunnel is established, but no traffic passes and the counter packets to non existent tunnel will increase. Other ports may function normally. Workaround: Disable or Enable either the tunneled-node-profile or the UBT user port.	Tunneled Node
16.11.0006	256681	KB WC	3810M 5400R 2930F 2930M	Symptom: Loop protect does not block the PBT enabled port in tunnel established/establishing state. Scenario: This issue occurred when the loop protect was enabled or configured for a PBT-enabled port in the tunnel-established state. Workaround: Disable or enable PBT for the affected ports. When using PBT, it is recommended to use STP instead of loop protect. If inevitable, loop protect must be enabled first and then the PBT on the port.	Tunneled Node

Upgrade Information

This chapter provides upgrading restrictions and guidelines for the following software platforms:

- [KB 16.11](#)
- [WC 16.11](#)

- [YA/YB 16.11](#)
- [YC 16.11](#)

KB 16.11

KB.16.11.0021 uses BootROM KB.16.01.0006 when running on 5400R switches and BootROM KB.16.01.0008 when running on 3810M switches. If your switch has an older version of BootROM, the BootROM will be updated with this version of software.

Some units of 5400R and 3810M switches may have BootROM version KB.16.01.0009 already and it remains unaffected.

IMPORTANT: During the software update, the switch will automatically boot twice. The switch will update the primary BootROM, then reboot, and then update the secondary BootROM. After the switch flash memory is updated and the final boot is initiated, no additional user intervention is needed. Do not interrupt power to the switch during this important update.

Firmware downgrade to a version earlier than 16.01 is not allowed if MSTP instances configured are greater than 16; or the max-vlans value is greater than 2048, or this system is part of a VSF stack.

Unconfigure these features before attempting to downgrade from KB.16.01.0004 or later to a version earlier than 16.01 of the firmware.

Firmware downgrade to a version earlier than 16.04 will generate new SSH keys upon switch boot-up. These keys will be different than the ones previously stored in SSH peer's known hosts file and may result in SSH connectivity issues after the OS downgrade completes. You will need to erase the pre-existing switch keys from SSH peer's known hosts file to restore SSH connectivity.

This issue will not be encountered when the option "StrictHostKeyChecking" is disabled in the SSH peer. For more information regarding clearing SSH keys and changing strict host key checking settings, see the documentation provided with your SSH client.

For information on best practices when updating software or rolling back to previous versions of software, see the "Best practices for software updates" section of the Basic Operation Guide.

WC 16.11

WC.16.11.0021 uses BootROM WC.16.01.0010 when running on 2930F switches and BootROM WC.17.02.0007 when running on 2930M switches. If your switch has an older version of BootROM, the BootROM will be updated with this version of software.

IMPORTANT: During the software update, the switch will automatically boot twice. The switch will update the primary BootROM, then reboot, and then update the secondary BootROM. After the switch flash memory is updated and the final boot is initiated, no additional user intervention is needed. Do not interrupt power to the switch during this important update.

Firmware downgrade to a version earlier than 16.04 will generate new SSH keys upon switch boot-up. These keys will be different than the ones previously stored in SSH peer's known hosts file and may result in SSH connectivity issues after the OS downgrade completes. You will need to erase the pre-existing switch keys from SSH peer's known hosts file to restore SSH connectivity.

This issue will not be encountered when the option "StrictHostKeyChecking" is disabled in the SSH peer. For more information regarding clearing SSH keys and changing strict host key checking settings, see the documentation provided with your SSH client.

For information on best practices when updating software or rolling back to previous versions of software, see the "Best practices for software updates" section of the Basic Operation Guide.

YA/YB 16.11

YA/YB.16.11.0021 uses BootROM YA.15.20/YB.15.10. If your switch has an older version of BootROM, the BootROM will be updated with this version of software.

IMPORTANT: During the software update, the switch will automatically boot twice. The switch will update the primary BootROM, then reboot, and then update the secondary BootROM. After the switch flash memory is updated and the final boot is initiated, no additional user intervention is needed. Do not interrupt power to the switch during this important update.

Firmware downgrade to a version earlier than 16.04 will generate new SSH keys upon switch boot-up. These keys will be different than the ones previously stored in SSH peer's known hosts file and may result in SSH connectivity issues after the OS downgrade completes. You will need to erase the pre-existing switch keys from SSH peer's known hosts file to restore SSH connectivity.

This issue will not be encountered when the option "StrictHostKeyChecking" is disabled in the SSH peer. For more information regarding clearing SSH keys and changing strict host key checking settings, see the documentation provided with your SSH client.

For information on best practices when updating software or rolling back to previous versions of software, see the "Best practices for software updates" section of the **Basic Operation Guide**.

YC 16.11

YC.16.11.0021 uses BootROM YC.16.01.0003. If your switch has an older version of BootROM, the BootROM will be updated with this version of software.

IMPORTANT: During the software update, the switch will automatically boot twice. The switch will update the primary BootROM, then reboot, and then update the secondary BootROM. After the switch flash memory is updated and the final boot is initiated, no additional user intervention is needed. Do not interrupt power to the switch during this important update.

Firmware downgrade to a version earlier than 16.04 will generate new SSH keys upon switch boot-up. These keys will be different than the ones previously stored in SSH peer's known hosts file and may result in SSH connectivity issues after the OS downgrade completes. You will need to erase the pre-existing switch keys from SSH peer's known hosts file to restore SSH connectivity.

This issue will not be encountered when the option "StrictHostKeyChecking" is disabled in the SSH peer. For more information regarding clearing SSH keys and changing strict host key checking settings, see the documentation provided with your SSH client.

For information on best practices when updating software or rolling back to previous versions of software, see the "Best practices for software updates" section of the Basic Operation Guide.

Aruba Security Policy

A Security Bulletin is the first published notification of security vulnerabilities and is the only communication vehicle for security vulnerabilities.

- Fixes for security vulnerabilities are not documented in manuals, release notes, or other forms of product documentation.
- A Security Bulletin is released when all vulnerable products still in support life have publicly available images that contain the fix for the security vulnerability.

The Aruba security policy can be found at <https://www.arubanetworks.com/en-au/support-services/sirt/>. Security bulletins can be found at <https://www.arubanetworks.com/en-au/support-services/security-bulletins/>.